

General Information

Date & Time: 21, Jul, 2026 15:45

Make	Mitsubishi	Model	L300
YOM	2026	Odo Meter Reading	3,142
Registration No.	NLC2312	Chassis No.	PAEL65NYTSB010667
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



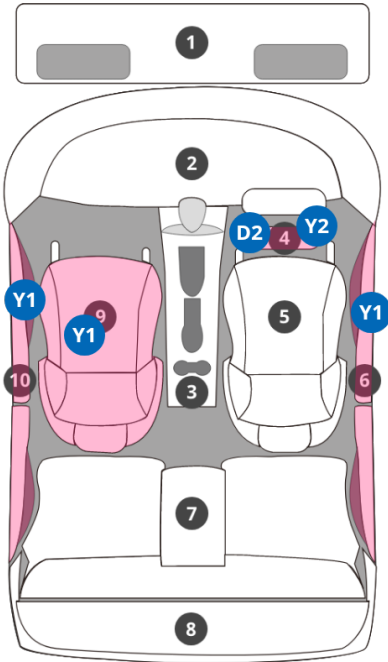
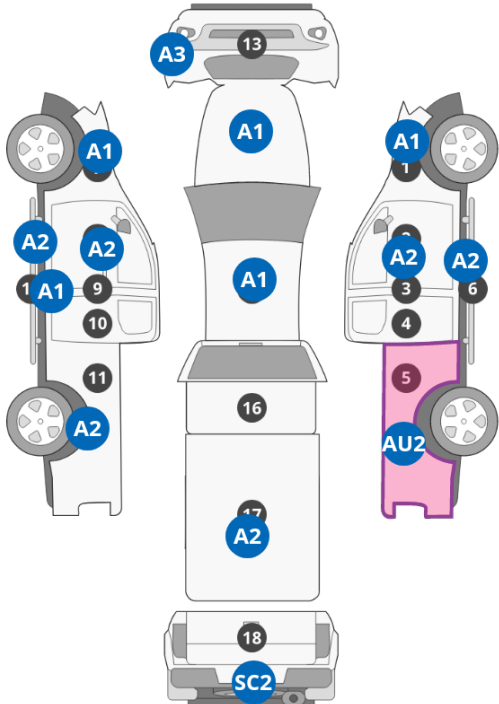
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	93.3	95	97	88
2	Boot Lid	87.2	88	87	87
3	Roof	80.9	78	79	82/85
4	Left Front Fender	90.4	92	87	92
5	Left Front Door	82.2	81	80	85
6	Center Panel Left	93.3	97	94	89
7	Left Rear Door				
8	Left Back Panel	110.0	107	113	110
9	Right Front Fender	101.8	86	127	93
10	Right Front Door	78.8	85	75	77
11	Center Panel Right	95.9	100	95	93
12	Right Rear Door				
13	Right Back Panel	105.4	98	122	96

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Center Panel - Scratch - Minimal / (L) Side Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Rust, Corrosion - Small / Cargo Bed Floor - Scratch - Small / (R) Side Gate - Repair mark - Yes / (R) Side Gate - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Front Panel - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with warranty booklet/with tools and jack/with spare tire/acid rain on the body/hairline scratches on the body/with spare key