

General Information

Date & Time: 22, Jul, 2026 07:42

Make	Mitsubishi	Model	L300
YOM	2026	Odo Meter Reading	11,403
Registration No.	NLB1721	Chassis No.	PAEL65NYTSB010399
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



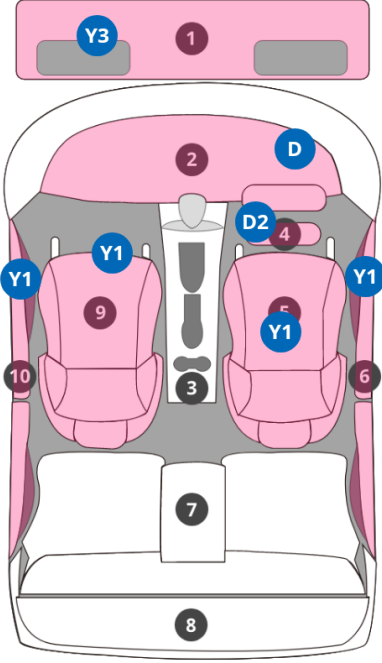
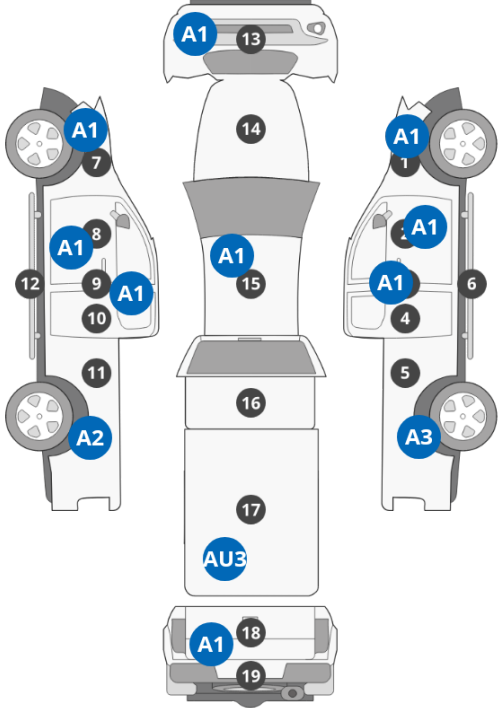
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	84.1	81	85	86
2	Boot Lid	78.7	74	66	97
3	Roof	83.2	76	74	114/70
4	Left Front Fender	78.6	80	80	75
5	Left Front Door	75.2	76	76	74
6	Center Panel Left	84.2	89	83	81
7	Left Rear Door				
8	Left Back Panel	102.5	108	80	120
9	Right Front Fender	78.2	83	73	79
10	Right Front Door	71.8	75	69	73
11	Center Panel Right	94.9	97	95	93
12	Right Rear Door				
13	Right Back Panel	101.8	97	98	110

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Sunvisor, Sunglass Holder - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Center Panel - Scratch - Minimal / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch - Minimal / Cargo Bed Floor - Scratch & Dent - Medium / (L) Side Gate - Scratch - Small / (L) Center Panel - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Roof - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plate/with warranty booklet/with spare tire/with hairlines scratches on the body/without spare key/without tools and jack/without reverse camera