

General Information

Date & Time: 26, Jul, 2026 17:16

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	30,156
Registration No.	GBF7180	Chassis No.	PA1B18F33R4277063
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



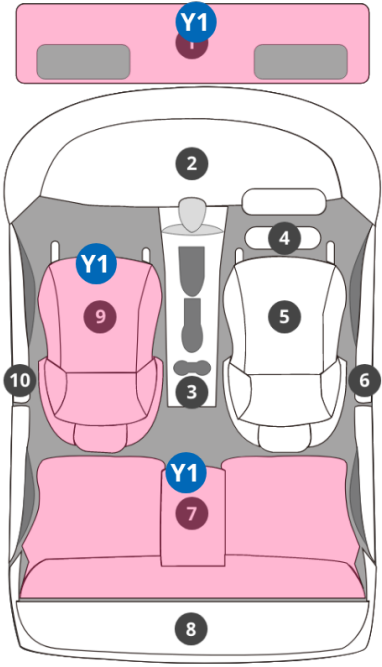
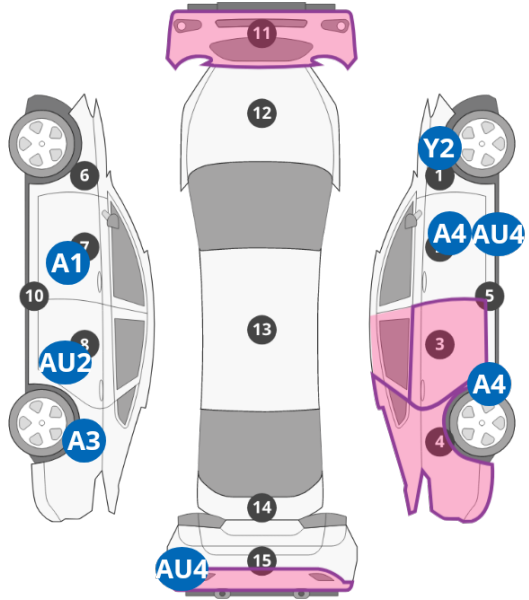
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	221.3	223	216	225
2	Boot Lid	237.3	230	236	246
3	Roof	200.7	211	226	194/172
4	Left Front Fender	233.0	254	226	219
5	Left Front Door	227.0	236	222	223
6	Center Panel Left				
7	Left Rear Door	227.0	245	222	214
8	Left Back Panel	228.0	233	227	224
9	Right Front Fender	227.0	222	226	233
10	Right Front Door	158.6	169	152	155
11	Center Panel Right				
12	Right Rear Door	261.6	270	261	254
13	Right Back Panel	530.6	543	377	672

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Minimal / Ceiling - Grime - Minimal	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Small / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Fender, Molding - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
with Ito plates, no warranty booklet, no spare tire, tools and jack, with paintn droplets in the body, modified mugs at rear right wheel