

General Information

Date & Time: 23, Jul, 2026 15:46

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	46,148
Registration No.	NJJ1039	Chassis No.	MHFAA1BY3S0044964
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Green		

Body / Panel Condition



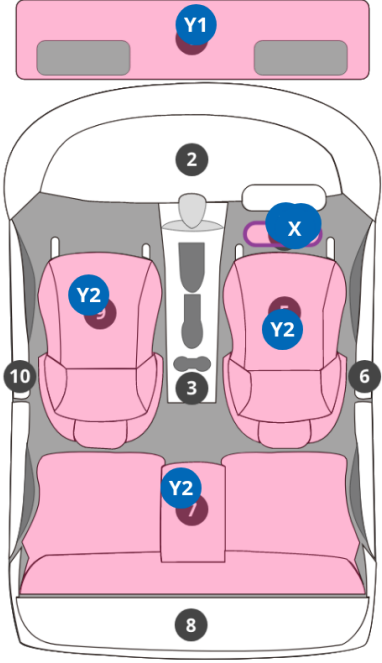
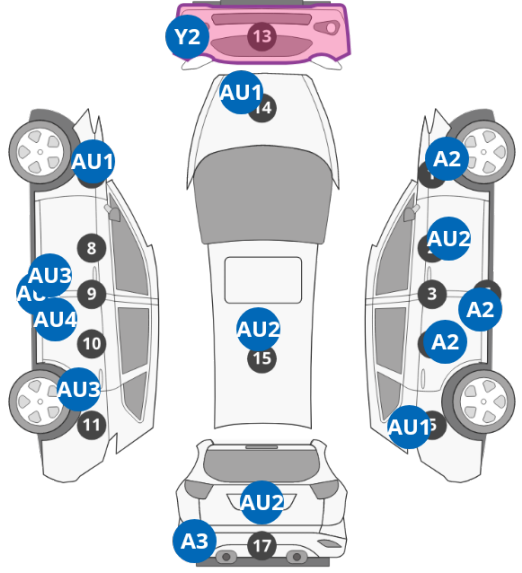
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.3	116	113	126
2	Boot Lid	123.6	115	122	134
3	Roof	142.0	152	140	151/125
4	Left Front Fender	120.3	118	115	128
5	Left Front Door	132.6	124	136	138
6	Center Panel Left				
7	Left Rear Door	131.0	135	139	119
8	Left Back Panel	138.3	156	128	131
9	Right Front Fender	128.0	136	118	130
10	Right Front Door	126.0	132	125	121
11	Center Panel Right				
12	Right Rear Door	124.6	131	121	122
13	Right Back Panel	130.0	137	125	128

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Rear Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Ceiling - Grime - Minimal	Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Small / Bonnet, Headlight - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Fender, Molding - Scratch - Small
Frame Evaluation : D	Functional Evaluation : A
Remarks Left Center Pillar - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with reverse camera, with manual and warranty booklet, no tools and jack, no spare key, scratches and dent on exterior, scratches in taillight and headlight.