

General Information

Date & Time: 24, Jul, 2026 15:42

Make	Toyota	Model	Avanza
YOM	2024	Odo Meter Reading	66,209
Registration No.	NHS5169	Chassis No.	MHFAA1BYXR0028609
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	MPV
Colour	Green		

Body / Panel Condition



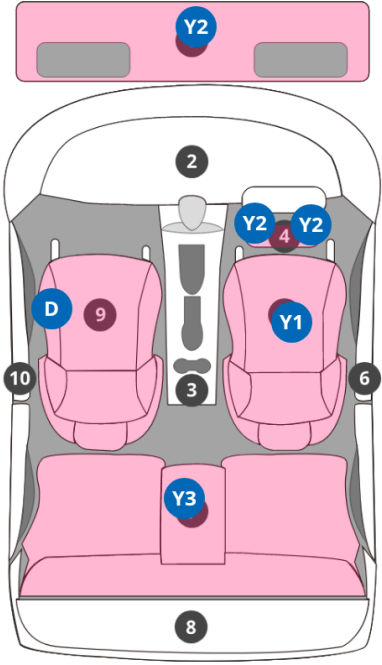
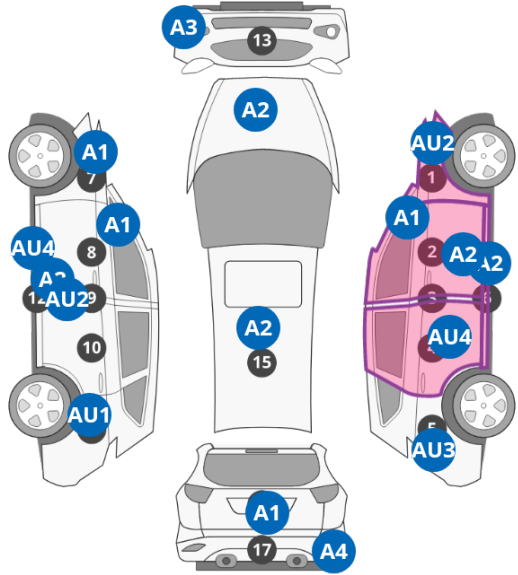
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	110	106	118
2	Boot Lid	116.0	115	126	107
3	Roof	124.0	131	127	115/123
4	Left Front Fender	104.0	110	100	102
5	Left Front Door	124.3	115	123	135
6	Center Panel Left				
7	Left Rear Door	121.3	128	113	123
8	Left Back Panel	115.3	129	115	102
9	Right Front Fender	185.6	211	205	141
10	Right Front Door	470.0	1,086	163	161
11	Center Panel Right				
12	Right Rear Door	187.3	166	171	225
13	Right Back Panel	115.0	103	111	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Minimal / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Grime - Small / Ceiling - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate/no warranty booklet/with incomplete tools no jack/with spare tire/rear right quarter glass damaged/no spare key/maintenance warning lamp on/hairline scratches on the body/traces of adhesive on exterior/plate light issue