

General Information

Date & Time: 23, Jul, 2026 07:56

Make	Mitsubishi	Model	L300
YOM	2026	Odo Meter Reading	15,084
Registration No.	NJM1203	Chassis No.	PAEL65NYTSB012153
CC	2.2	Transmission	M/T
Fuel Type	Diesel	Type of Body	FB Body
Colour	White		

Body / Panel Condition



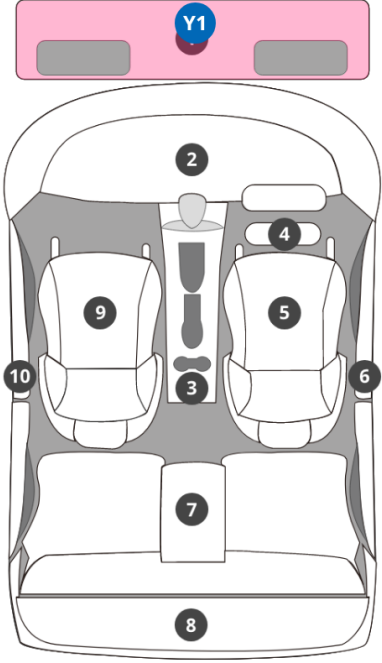
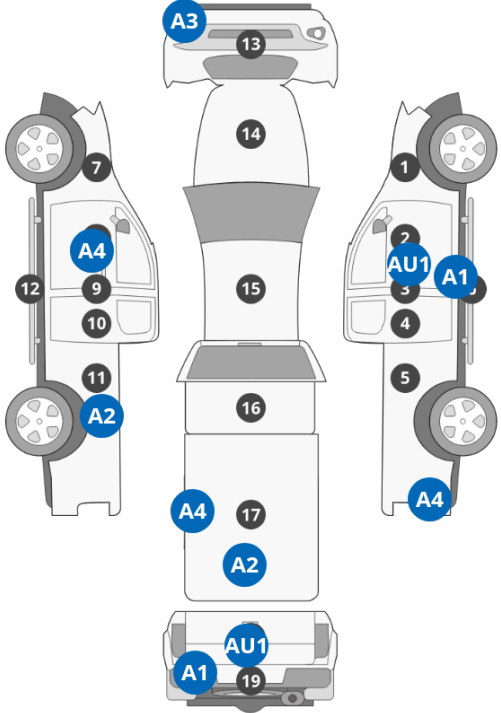
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	77.0	77	76	78
2	Boot Lid	78.1	82	60	93
3	Roof	75.8	75	80	79/70
4	Left Front Fender	80.0	81	77	82
5	Left Front Door	72.9	72	70	77
6	Center Panel Left	79.1	81	80	77
7	Left Rear Door				
8	Left Back Panel	124.4	195	69	109
9	Right Front Fender	75.4	78	74	75
10	Right Front Door	71.3	73	70	72
11	Center Panel Right	76.9	79	80	72
12	Right Rear Door				
13	Right Back Panel	88.5	82	84	100

Overall Evaluation :

A

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal	Remarks (L) Rear Corner Panel - Repair Traces - Yes / (R) Front Door, Molding - Scratch & Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Side Gate - Scratch - Large / Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / Cargo Bed Floor - Scratch - Small / (L) Side Gate - Scratch - Small / Roof - Scratch - Large / (L) Front Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes

With Lto plate, with spare tire and jack, with warranty booklet, 2keys, no tools,