

General Information

Date & Time: 25, Jul, 2026 15:44

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	14,567
Registration No.	NJC3320	Chassis No.	PAHACACA0S6423771
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



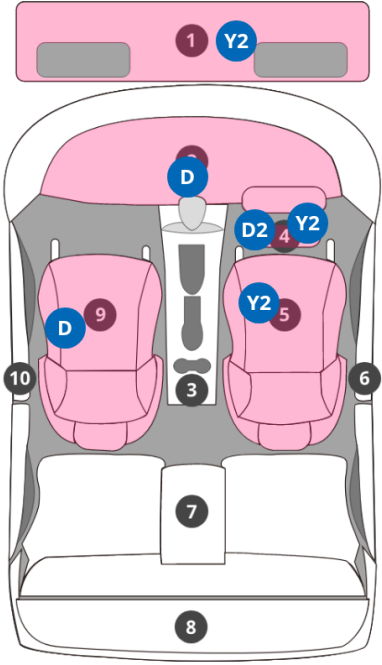
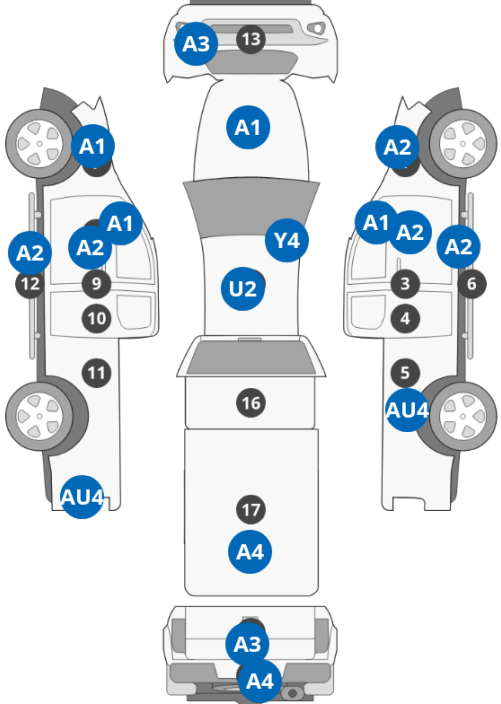
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.0	95	105	95
2	Boot Lid	69.6	73	58	78
3	Roof	113.2	123	114	114/102
4	Left Front Fender	101.8	99	102	105
5	Left Front Door	103.3	102	107	101
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	56.2	57	61	51
9	Right Front Fender	98.3	100	101	94
10	Right Front Door	103.3	99	105	106
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	67.8	63	83	58

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / Rear Gate - Scratch - Medium / Cargo Bed Floor - Scratch - Large / (R) Side Gate - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Front Windshield - Damaged - Large / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with warranty booklet/with incomplete tools with jack/with spare tire/no spare key/front windshield damaged/rear room light issue/rear headlining loose/hairline scratches on the body