

General Information

Date & Time: 27, Jul, 2026 08:36

Make	Toyota	Model	Innova
YOM	2025	Odo Meter Reading	40,378
Registration No.	NJF6921	Chassis No.	PA2JA8EM6S0155831
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



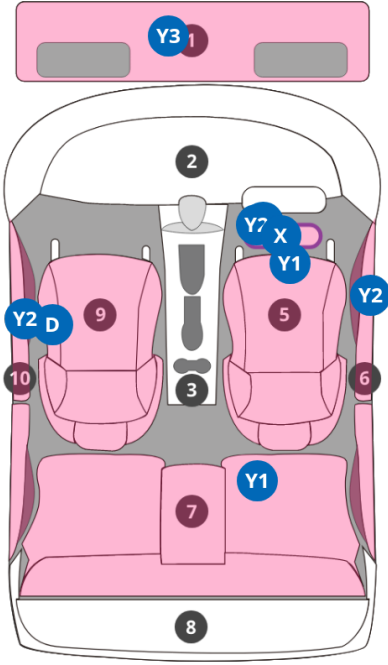
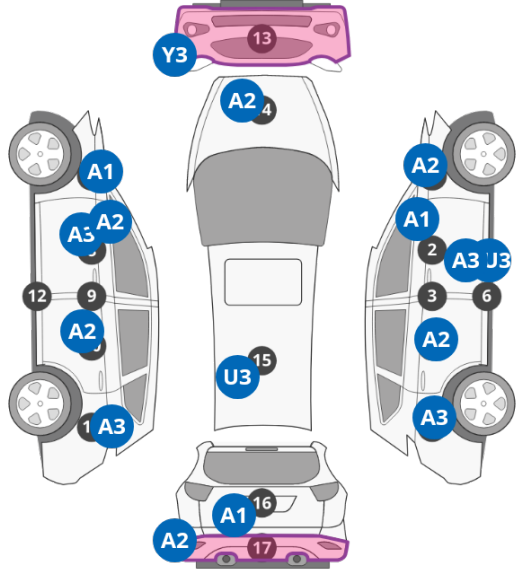
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	124.0	124	125	123
2	Boot Lid	205.3	216	195	205
3	Roof	98.3	105	102	93/94
4	Left Front Fender	103.0	104	105	100
5	Left Front Door	109.6	111	108	110
6	Center Panel Left				
7	Left Rear Door	105.0	106	106	103
8	Left Back Panel	115.6	113	116	118
9	Right Front Fender	112.0	112	108	116
10	Right Front Door	114.3	115	119	109
11	Center Panel Right				
12	Right Rear Door	104.3	108	101	104
13	Right Back Panel	150.0	161	141	148

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Minimal / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Grime - Small / Mat Other - Missing - Yes / Rear Seat - Grime - Minimal	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Medium / Bonnet, Headlight - Scratch - Small / Roof - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratched and cracked headlight, scratches on tail light, brake and tail light issue,