

General Information

Date & Time: 23, Jul, 2026 15:58

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	26,008
Registration No.	NFF2104	Chassis No.	PA1B18F33P4233142
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



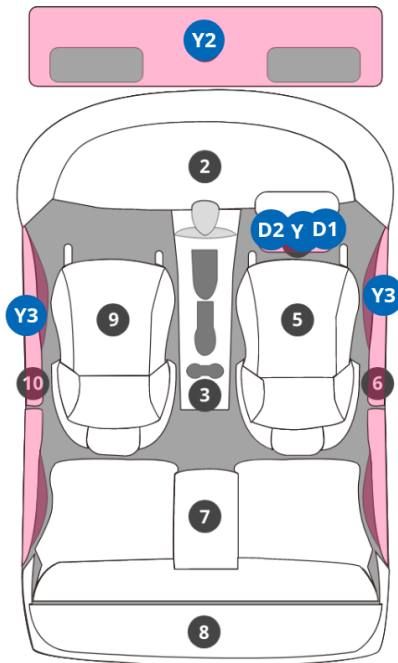
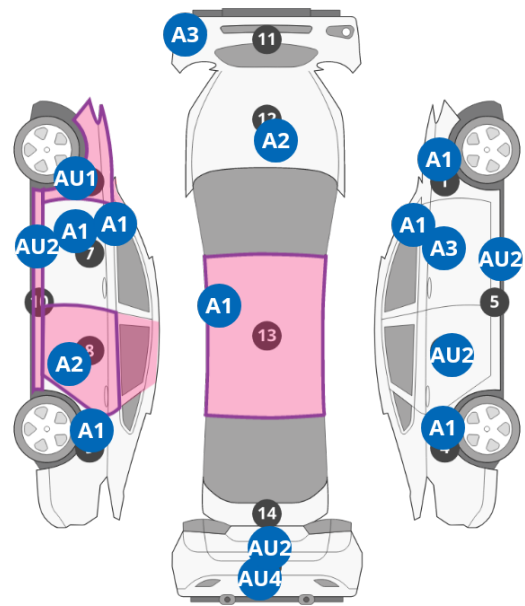
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.3	106	104	103
2	Boot Lid	109.3	105	106	117
3	Roof	129.0	127	136	129/124
4	Left Front Fender	270.0	203	204	403
5	Left Front Door	144.6	125	132	177
6	Center Panel Left				
7	Left Rear Door	398.0	248	777	169
8	Left Back Panel	151.0	159	157	137
9	Right Front Fender	101.8	103	103	100
10	Right Front Door	103.6	101	108	102
11	Center Panel Right				
12	Right Rear Door	100.3	102	98	101
13	Right Back Panel	108.4	99	105	121

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Minimal / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small / Carpet - Worked - Minimal	Remarks (L) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small / Roof - Repair mark - Yes / Roof Spoiler, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 3keys, no tools, scratches on headlights and taillights, possible flooding