

General Information

Date & Time: 24, Jul, 2026 11:13

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	59,745
Registration No.	CBT4281	Chassis No.	PA1B18F30P4202589
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



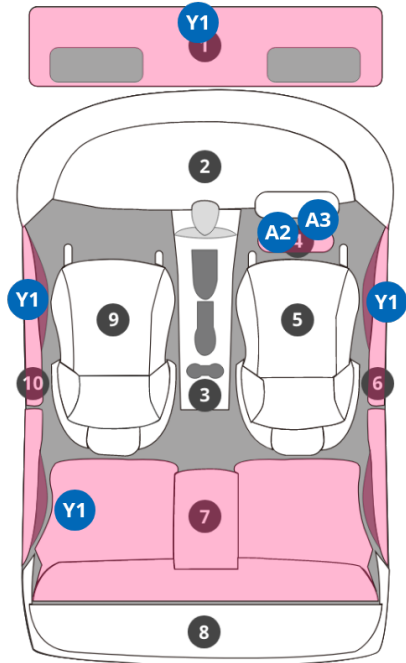
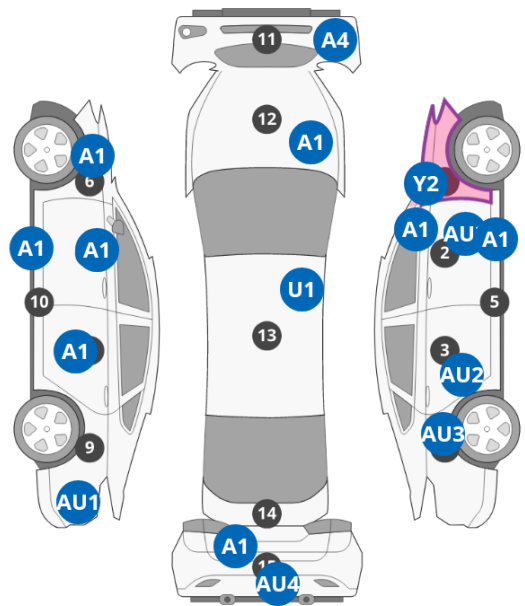
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	120	106	111
2	Boot Lid	112.0	114	98	124
3	Roof	92.0	103	78	92/96
4	Left Front Fender	103.6	103	102	106
5	Left Front Door	100.1	101	98	101
6	Center Panel Left				
7	Left Rear Door	99.0	102	98	97
8	Left Back Panel	105.3	108	106	102
9	Right Front Fender	534.0	376	574	652
10	Right Front Door	102.5	99	100	109
11	Center Panel Right				
12	Right Rear Door	100.3	98	97	106
13	Right Back Panel	198.6	311	145	140

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Minimal / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal / Carpet - Worn, Scratch, Cut, Crack - Small / (L) Front Floor Mat - Cut, Crack - Medium	Remarks (R) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Difference in Color / (R) Front Fender, Molding - Crack, Gap - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 1key, no tools, scratches on headlights and taillights, battery weak, possible flooding