

General Information

Date & Time: 27, Jul, 2026 13:12

Make	Hyundai	Model	H100
YOM	2018	Odo Meter Reading	78,682
Registration No.	NEA6788	Chassis No.	KMFZBBX7BAHU489525
CC	2.6	Transmission	M/T
Fuel Type	Diesel	Type of Body	Shuttle
Colour	White		

Body / Panel Condition



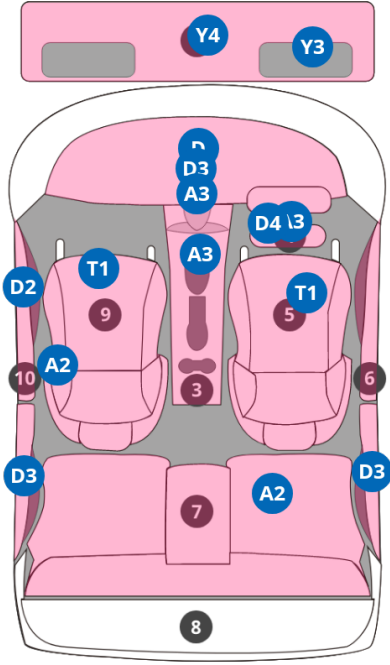
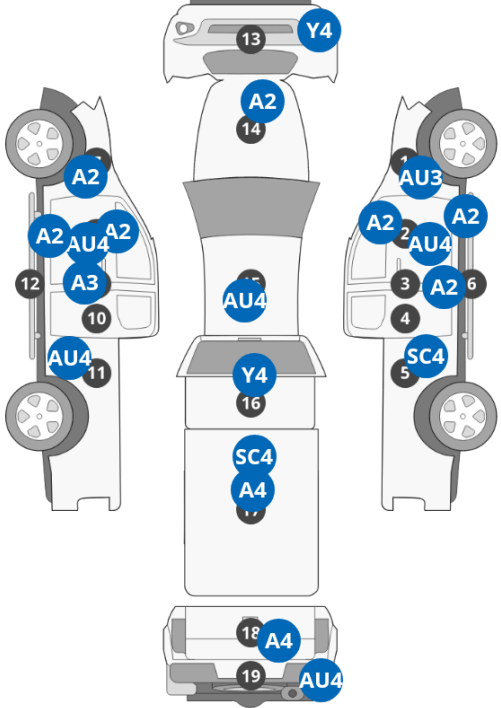
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	135.0	165	133	107
2	Boot Lid	113.0	114	99	126
3	Roof	71.9	67	66	77/78
4	Left Front Fender	271.6	454	190	171
5	Left Front Door	107.3	105	110	107
6	Center Panel Left	130.5	123	170	99
7	Left Rear Door				
8	Left Back Panel	344.8	90	834	111
9	Right Front Fender	1,015.3	1,132	1,277	637
10	Right Front Door	127.3	121	114	147
11	Center Panel Right	111.6	103	122	110
12	Right Rear Door				
13	Right Back Panel	137.6	156	126	131

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Ceiling - Grime - Large / (R) Front Seat - Cigarette Burns - Burnt Minimal / (L) Front Seat - Cigarette Burns - Burnt Minimal / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Medium / (L) Front Floor Mat - Cut, Crack - Medium / Dashboard - Loose, Deformed - Medium / Steering Wheel - Worn, Peel, Crack - Medium / Carpet - Worked - Large / (L) Front Seat belt - Cut, Crack - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Medium / Rear Seat - Cut, Crack - Small / (L) Front Trim - Loose, Deformed - Small / Trim Other - Loose, Deformed - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Center Panel - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Side Gate - Rust, Corrosion - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Gate - Scratch - Large / Cargo Bed Floor - Rust, Corrosion - Large / Cab Back Panel - Scratch - Large / (L) Side Gate - Scratch & Dent - Large / (L) Center Panel - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Large / Roof - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Small / Front Windshield - Damaged - Large / (L) Step, In-panel, Side Spoiler - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes

Inspector Notes
With Lto plate, with spare tire and jack, 2keys, no warranty booklet and tools, scratches on headlights and taillights, aircon issue,