

General Information

Date & Time: 28, Jul, 2026 15:43

Make	Toyota	Model	Wigo
YOM	2014	Odo Meter Reading	105,829
Registration No.	AAP1346	Chassis No.	MHKA4DF3F0J000561
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	White		

Body / Panel Condition



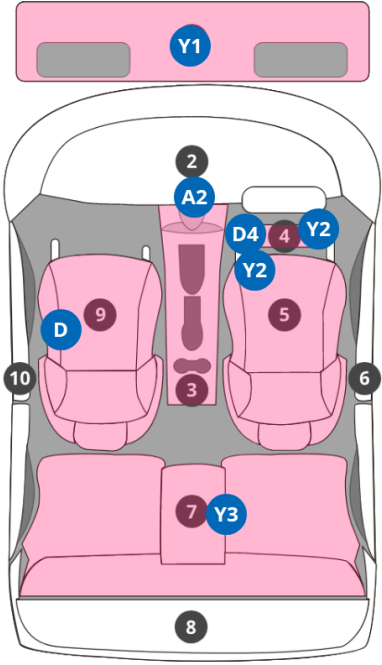
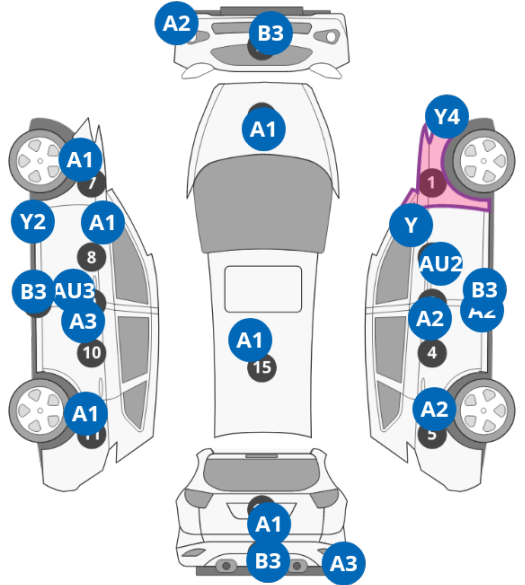
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	71.5	70	75	69
2	Boot Lid	91.3	85	98	92
3	Roof	65.3	64	71	66/61
4	Left Front Fender	82.3	85	87	76
5	Left Front Door	92.2	91	93	92
6	Center Panel Left				
7	Left Rear Door	95.2	98	95	93
8	Left Back Panel	87.9	103	86	75
9	Right Front Fender	330.3	83	94	815
10	Right Front Door	91.3	94	93	88
11	Center Panel Right				
12	Right Rear Door	90.6	98	87	87
13	Right Back Panel	88.1	83	86	95

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (R) Front Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Large / Ceiling - Grime - Minimal / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Crack, Gap - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Small / (R) Mirror - Crack - Cracks / (R) Front Fender, Molding - Crack, Gap - Large / Front Bumper, Grille, Lamps - Modified - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Minimal / Overall Exterior - Faded(Color, Gloss) - Yes / (R) Step, In-panel, Side Spoiler - Modified - Medium / (L) Step, In-panel, Side Spoiler - Modified - Medium / Rear Bumper, Lamps, Panels - Modified - Medium
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with LTO plate/no warranty/no tools with jack/with worn spare tire/aircon weak/plate light issue/button lights and cigarette lighter/bumper partially missing/side mirror adjuster issue/headlight cover issue/trunk door issue/abnormal engine noise and vibration/power steering issue due to weak battery/transmission issue/with spare key/hairline scratches on the body