

## General Information

Date & Time: 29, Jul, 2026 13:30

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Camry             |
| YOM              | 2018    | Odo Meter Reading | 158,717           |
| Registration No. | NCV4611 | Chassis No.       | MK053AK50H9000545 |
| CC               | 2.5     | Transmission      | A/T               |
| Fuel Type        | Gas     | Type of Body      | Sedan             |
| Colour           | White   |                   |                   |

## Body / Panel Condition



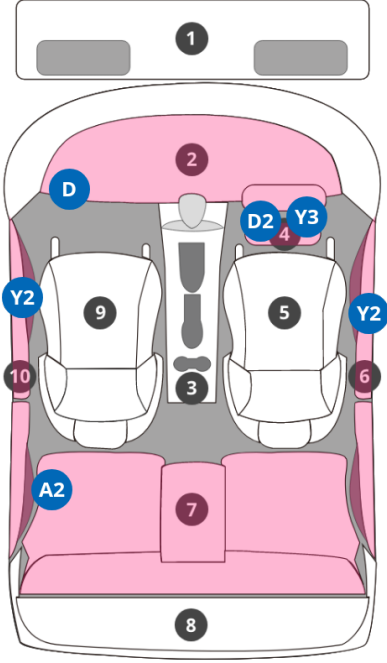
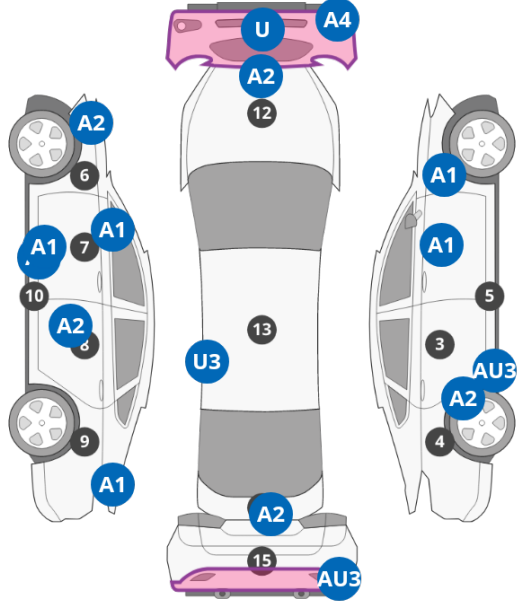
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 198.0         | 187    | 197    | 210      |
| 2  | Boot Lid           | 230.0         | 254    | 183    | 253      |
| 3  | Roof               | 114.7         | 133    | 128    | 105/93   |
| 4  | Left Front Fender  | 103.1         | 99     | 108    | 102      |
| 5  | Left Front Door    | 106.0         | 103    | 111    | 104      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 165.6         | 165    | 165    | 167      |
| 8  | Left Back Panel    | 148.3         | 166    | 144    | 135      |
| 9  | Right Front Fender | 97.7          | 98     | 96     | 100      |
| 10 | Right Front Door   | 111.6         | 118    | 114    | 103      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 98.5          | 96     | 93     | 107      |
| 13 | Right Back Panel   | 103.6         | 106    | 97     | 108      |

## Overall Evaluation :

C

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <b>C</b>                                                                                                                                                                                                                                                                     | Exterior Evaluation : <b>D</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                      |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                 |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
| <p><b>Remarks</b></p> <p>(R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Grime - Medium / Rear Seat - Cut, Crack - Small / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Worn as per age - Yes</p> | <p><b>Remarks</b></p> <p>Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / Roof - Dent - Medium / (L) Front Door, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal</p> |
| Frame Evaluation : <b>B</b>                                                                                                                                                                                                                                                                        | Functional Evaluation : <b>C</b>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                    |
| <p><b>Remarks</b></p> <p>Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>                                                                                                                                                                                      | <p><b>Remarks</b></p> <p>Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               |

| Inspector Notes                                                                                                                                  |
|--------------------------------------------------------------------------------------------------------------------------------------------------|
| with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on headlight and tail light, suncrack and yellowish headlights |