

General Information

Date & Time: 31, Jul, 2026 15:12

Make	Toyota	Model	Wigo
YOM	2022	Odo Meter Reading	80,677
Registration No.	FAJ6075	Chassis No.	MHKA4DF5FNJ069966
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



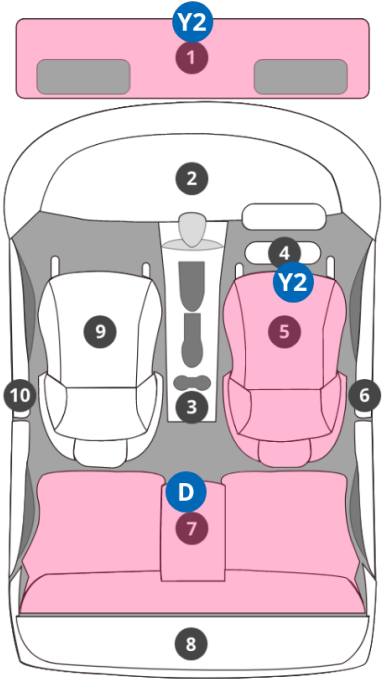
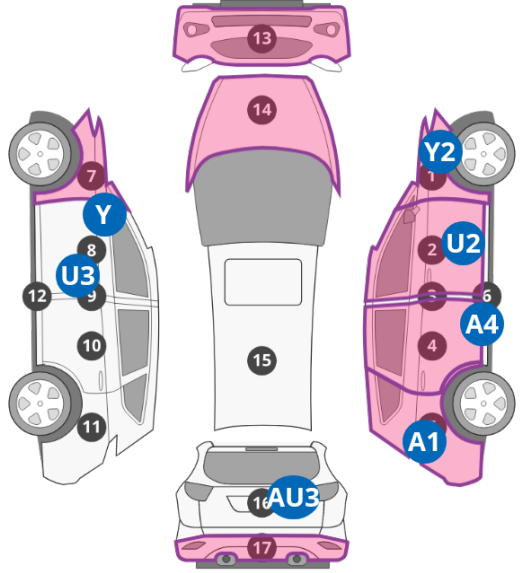
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	113.6	102	107	132
2	Boot Lid	87.8	84	98	82
3	Roof	75.7	75	77	80/71
4	Left Front Fender	174.0	226	154	142
5	Left Front Door	329.6	121	108	760
6	Center Panel Left				
7	Left Rear Door	122.6	137	112	119
8	Left Back Panel	485.6	687	182	588
9	Right Front Fender	454.3	164	163	1,036
10	Right Front Door	144.3	103	117	213
11	Center Panel Right				
12	Right Rear Door	88.5	90	89	87
13	Right Back Panel	115.6	141	105	101

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Worn - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Crack, Gap - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Dent - Medium / (L) Mirror - Crack - Cracks / Bonnet, Headlight - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with Ito plates, with warranty booklet, with spare tire, no jack and tools, with hairkune scratches in the body, rear left visor missing other visors worn