

General Information

Date & Time: 31, Jul, 2026 15:35

Make	Suzuki	Model	Ertiga
YOM	2025	Odo Meter Reading	9,698
Registration No.	FNV2217	Chassis No.	MHYNC32S6TJ101938
CC	1.5	Transmission	A/T
Fuel Type	Hybrid	Type of Body	Wagon
Colour	Red		

Body / Panel Condition



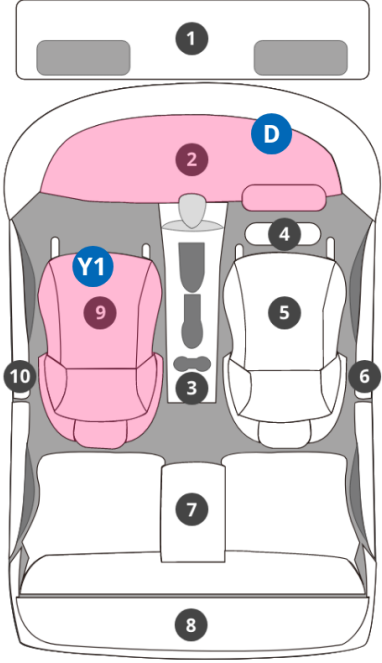
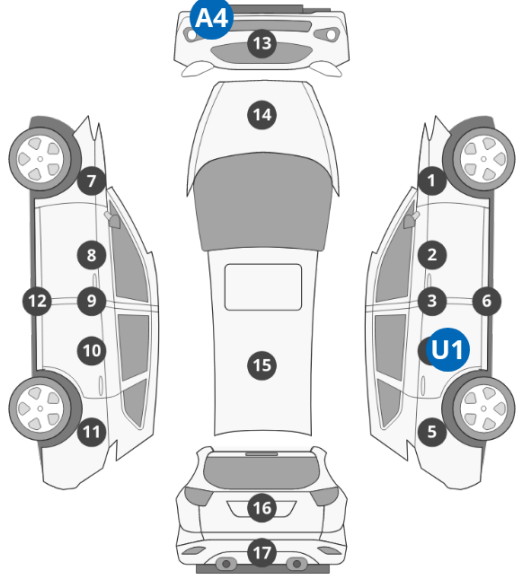
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.3	90	73	84
2	Boot Lid	82.9	77	91	81
3	Roof	79.3	78	85	75/80
4	Left Front Fender	68.1	69	68	68
5	Left Front Door	82.3	83	83	81
6	Center Panel Left				
7	Left Rear Door	85.5	93	82	81
8	Left Back Panel	75.5	79	77	70
9	Right Front Fender	62.4	64	61	62
10	Right Front Door	84.6	85	80	90
11	Center Panel Right				
12	Right Rear Door	84.6	83	81	91
13	Right Back Panel	69.0	67	70	70

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Rear Door, Molding - Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Large
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Air Conditioner - Function - Weak

Inspector Notes

with lto plates, no warranty booklet, with spare tire, n(o jack, no tools, windshield tint issue, abnormal noise under the hood, traction alarm, abs alarm, esp system alarm, airbag alarm, with hairline scratches in the body, master warning light on