

## General Information

Date & Time: 29, Jul, 2026 13:44

|                  |         |                   |                   |
|------------------|---------|-------------------|-------------------|
| Make             | Toyota  | Model             | Alphard           |
| YOM              | 2019    | Odo Meter Reading | 100,979           |
| Registration No. | NDI1754 | Chassis No.       | JTNGZ3DH6K6050892 |
| CC               | 3.5     | Transmission      | A/T               |
| Fuel Type        | Gas     | Type of Body      | Van               |
| Colour           | White   |                   |                   |

## Body / Panel Condition



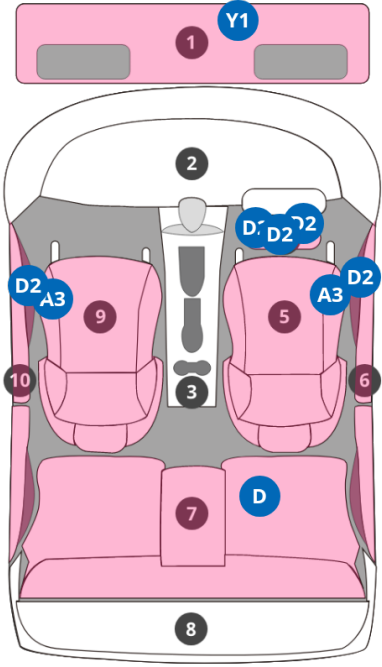
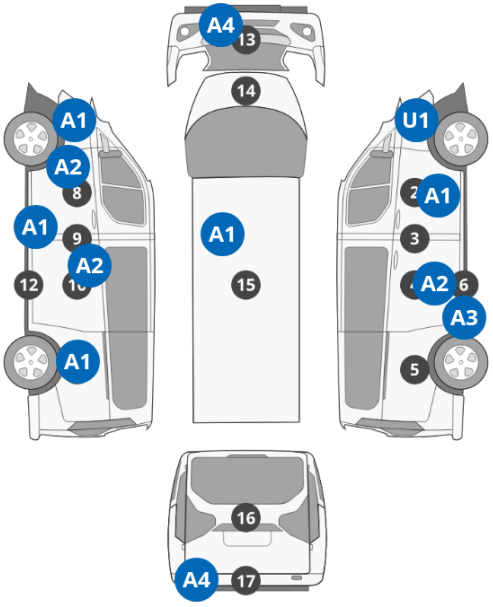
| #  | Area               | Thickness(um) |        |        |          |
|----|--------------------|---------------|--------|--------|----------|
|    |                    | Average       | Value1 | Value2 | Value3/4 |
| 1  | Bonnet             | 145.6         | 148    | 143    | 146      |
| 2  | Boot Lid           | 138.0         | 139    | 135    | 140      |
| 3  | Roof               | 139.2         | 140    | 137    | 144/136  |
| 4  | Left Front Fender  | 148.0         | 150    | 150    | 144      |
| 5  | Left Front Door    | 144.3         | 148    | 146    | 139      |
| 6  | Center Panel Left  |               |        |        |          |
| 7  | Left Rear Door     | 146.0         | 147    | 143    | 148      |
| 8  | Left Back Panel    | 145.3         | 146    | 149    | 141      |
| 9  | Right Front Fender | 144.0         | 146    | 151    | 135      |
| 10 | Right Front Door   | 150.3         | 147    | 154    | 150      |
| 11 | Center Panel Right |               |        |        |          |
| 12 | Right Rear Door    | 140.6         | 148    | 139    | 135      |
| 13 | Right Back Panel   | 138.0         | 145    | 133    | 136      |

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

| Interior Evaluation : <span>C</span>                                                                                                                                                                                                                                                                                              | Exterior Evaluation : <span>C</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                            |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|  <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>                                                                                |  <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>                                                                                                                                                                                                                                                                                                                                        |
| <b>Remarks</b><br>(L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / (L) Front Seat - Cut, Crack - Medium / (R) Front Seat - Cut, Crack - Medium / Rear Seat - Worn - Yes / (L) Front Trim - Worked - Small / (R) Front Trim - Worked - Small / Mat Other - Worked - Small / Ceiling - Grime - Minimal | <b>Remarks</b><br>Trunk Hood, Rear Gate - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Dent - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Overall Exterior - Faded(Color, Gloss) - Yes / Roof - Scratch - Minimal |
| Frame Evaluation : <span>A</span>                                                                                                                                                                                                                                                                                                 | Functional Evaluation : <span>A</span>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
| <b>Remarks</b><br>Defects not found                                                                                                                                                                                                                                                                                               | <b>Remarks</b><br>Remote Key & Smart entry - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                             |

| Inspector Notes                                                                                                                                                                                   |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| with Ito plate/with warranty booklet/with spare tire/with tools and jack/with dent and scratches on the body/without spare remote key/key remote battery issue/rear trunk automatic button issue/ |