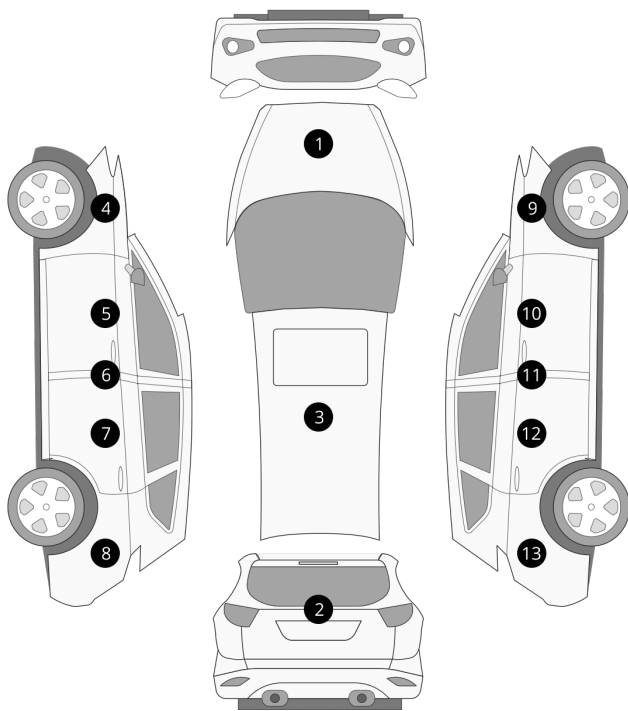


General Information

Date & Time: 30, Jul, 2026 14:27

Make	Nissan	Model	NV350
YOM	2020	Odo Meter Reading	67,461
Registration No.	NFZ1156	Chassis No.	JN1TC2E26Z0061895
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	Silver		

Body / Panel Condition



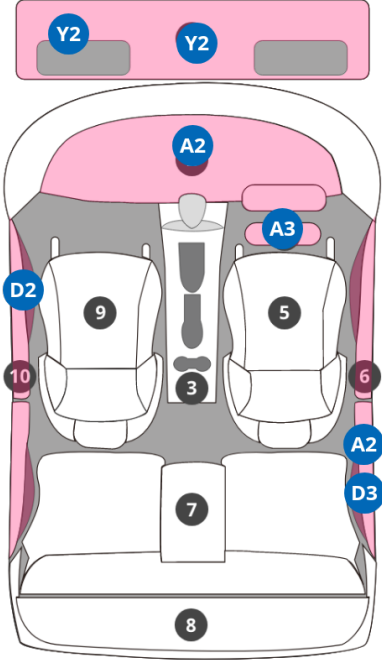
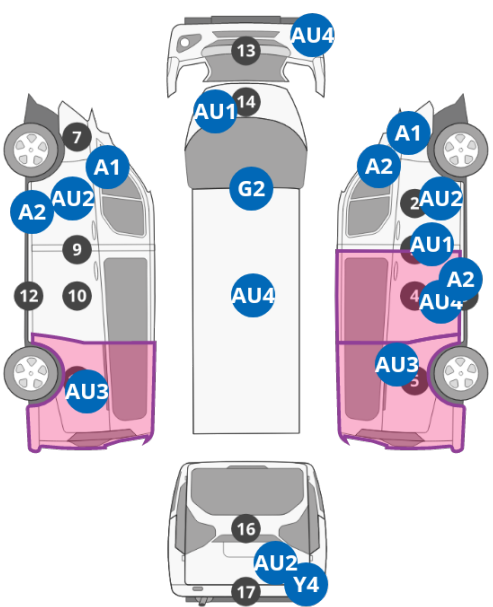
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.6	89	86	97
2	Boot Lid	105.6	84	106	127
3	Roof	99.5	92	86	128/93
4	Left Front Fender	98.0	92	101	101
5	Left Front Door	98.8	97	101	99
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	139.0	143	147	127
9	Right Front Fender	98.5	96	101	98
10	Right Front Door	129.3	141	118	129
11	Center Panel Right	99.5	111	106	82
12	Right Rear Door	188.0	239	160	165
13	Right Back Panel	209.3	140	140	348

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Rear Trim - Cut, Crack - Small / Trim Other - Loose, Deformed - Medium / Sunvisor, Sunglass Holder - Grime - Small / Ceiling - Grime - Small / Carpet - Worn, Scratch, Cut, Crack - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Worked - Small	Remarks (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Center Panel - Scratch & Dent - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Medium / Roof - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Front Panel - Scratch & Dent - Minimal / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Warning Lamps - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, with warranty booklet, 1key, no tools, scratches on headlights and taillights, check engine warning lamp on, battery weak, aircon issue, plate light issue