

General Information

Date & Time: 04, Mar, 2025 15:25

Make	Toyota	Model	Vios
YOM	2017	Mileage	160,999
Registration No.	NCN2466	Chassis No.	PA1B18F36H4019375
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



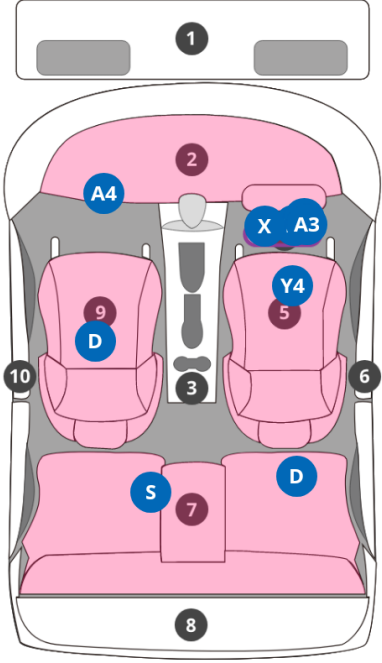
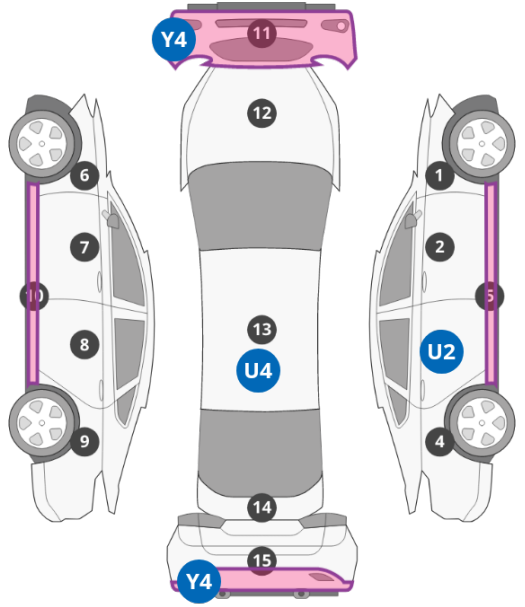
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	293.0	229	278	372
2	Boot Lid	244.6	246	245	243
3	Roof	186.5	204	191	183/168
4	Left Front Fender	511.6	526	547	462
5	Left Front Door	291.3	331	284	259
6	Center Panel Left				
7	Left Rear Door	221.6	205	218	242
8	Left Back Panel	291.6	205	376	294
9	Right Front Fender	457.6	556	427	390
10	Right Front Door	303.0	290	286	333
11	Center Panel Right				
12	Right Rear Door	490.3	414	556	501
13	Right Back Panel	287.6	240	310	313

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Worn - Yes / Mat Other - Grime - Large / (R) Front Seat - Grime - Large / (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Carpet - Worn, Scratch, Cut, Crack - Medium / (L) Front Seat - Worn - Yes / Overall Interior - Worn as per age - Yes / Overall Interior - Smell - Yes / Steering Wheel - Worn, Peel, Crack - Large	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / Roof - Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (R) Rear Door, Molding - Dent - Small
Frame Evaluation : C	Functional Evaluation : E
Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Panel, Meter - Issue - Yes / Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet/possible flooding/ no tools and spare tire/ no jack// trunk latch issue/