

General Information

Date & Time: 04, Mar, 2025 18:56

Make	Ford	Model	EcoSport
YOM	2017	Mileage	80,906
Registration No.	DAD6123	Chassis No.	MPBSXXMXKSHJ69608
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Brown		

Body / Panel Condition



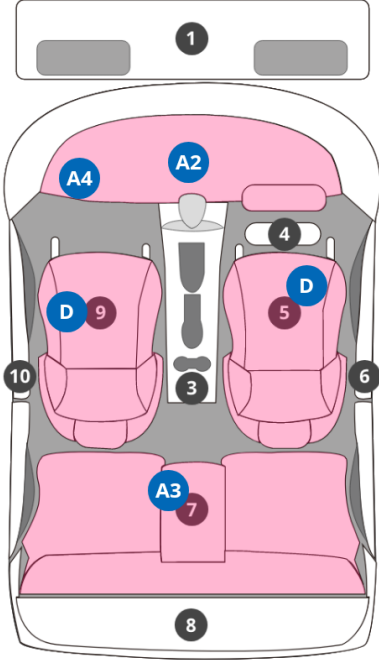
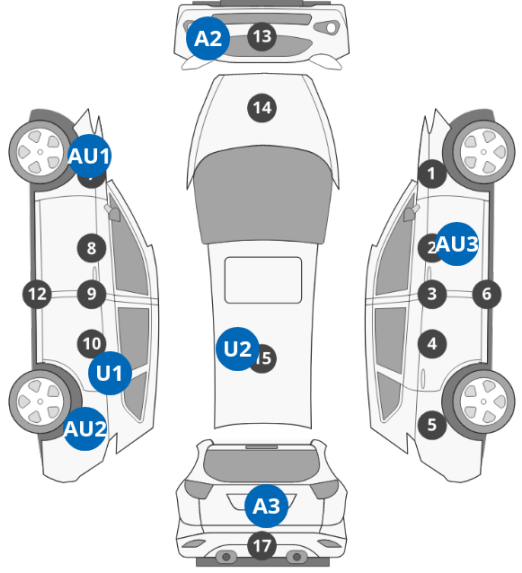
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	122.3	113	127	127
2	Boot Lid	102.6	96	123	89
3	Roof	104.6	98	97	113/110
4	Left Front Fender	131.6	125	141	129
5	Left Front Door	116.6	121	121	108
6	Center Panel Left				
7	Left Rear Door	107.3	107	111	104
8	Left Back Panel	110.6	116	102	114
9	Right Front Fender	283.3	148	301	401
10	Right Front Door	114.3	107	120	116
11	Center Panel Right				
12	Right Rear Door	106.3	100	114	105
13	Right Back Panel	111.2	119	95	120

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Cut, Crack - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / Dashboard - Worn, Scratch, Cut, Crack - Small / Overall Interior - Worn as per age - Yes / Steering Wheel - Worn, Peel, Crack - Large	Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Dent - Minimal / Trunk Hood, Rear Gate - Scratch - Medium / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with warranty booklet/ with spare tire and LTO plate/ no jack and tools/ no reverse light