

General Information

Date & Time: 04, Mar, 2025 18:14

Make	Isuzu	Model	D-MAX
YOM	2008	Mileage	205,346
Registration No.	ZSP136	Chassis No.	MPATFR54H6H589972
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



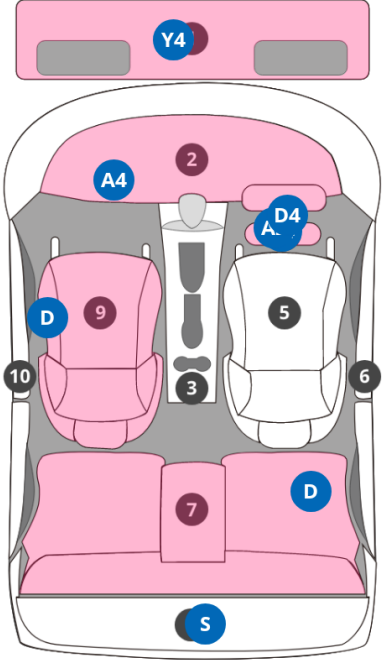
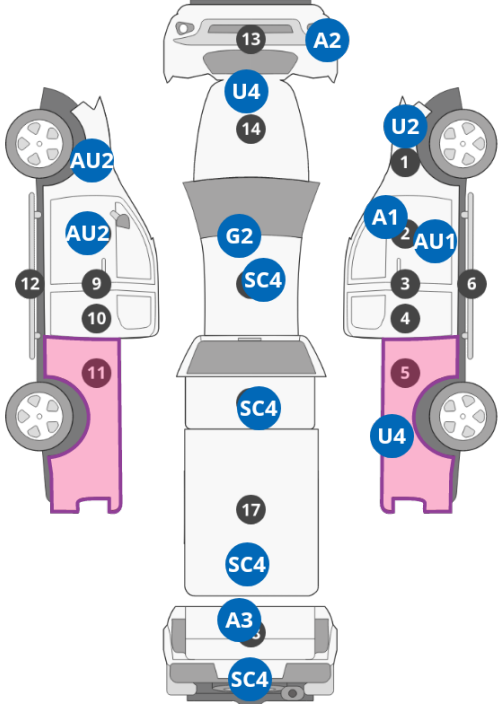
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.0	91	121	97
2	Boot Lid	242.0	264	233	229
3	Roof	120.9	87	159	115/123
4	Left Front Fender	114.3	110	130	103
5	Left Front Door	128.0	123	139	122
6	Center Panel Left	138.3	161	131	123
7	Left Rear Door				
8	Left Back Panel	209.0	190	216	221
9	Right Front Fender	107.0	105	117	99
10	Right Front Door	130.0	126	124	140
11	Center Panel Right	138.0	147	132	135
12	Right Rear Door				
13	Right Back Panel	222.3	206	248	213

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / (R) Front Floor Mat - Worked - Large / (R) Front Floor Mat - Cut, Crack - Small / Carpet - Loose, Deformed - Large / Ceiling - Grime - Large / Rear Seat - Worn - Yes / Steering Wheel - Worn, Peel, Crack - Large / (L) Front Seat - Worn - Yes / Overall Interior - Smell - Yes	Remarks (R) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Corner Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Dent - Small / Cargo Bed Floor - Rust, Corrosion - Large / Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Rust, Corrosion - Large / (R) Side Gate - Repair mark - Yes / (L) Side Gate - Repair mark - Yes / Roof - Rust, Corrosion - Large / (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Dent - Large / Front Bumper, Grille, Lamps - Scratch - Small / (R) Side Gate - Dent - Large / (R) Front Door, Molding - Scratch & Dent - Minimal / Cab Back Panel - Rust, Corrosion - Large / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Power Window (each) - Stuck, Gap - Yes / Air Conditioner - Function - Weak / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
with warranty booklet, with jack and tools, with spare tire, with LTO plate, right brake lights issue, crack on rear left signal light, air-conditioning issue, manual window issue