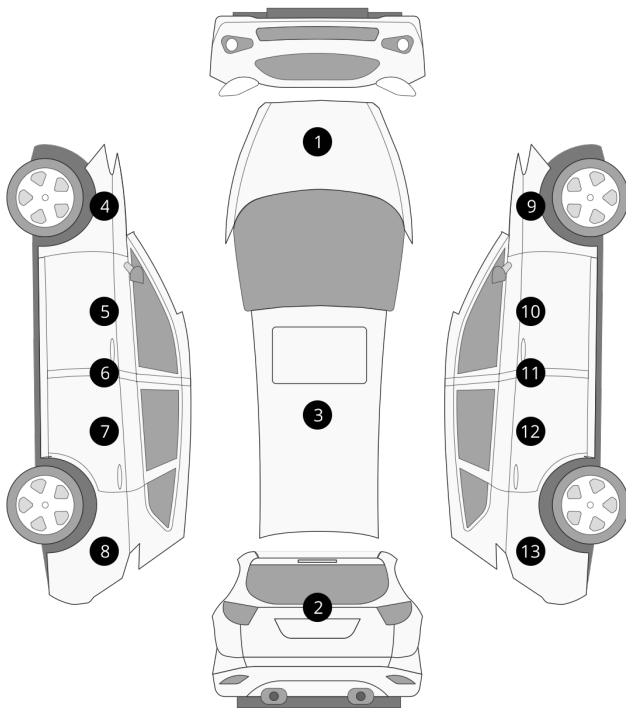


General Information

Date & Time: 23, Sep, 2024 13:36

Make	Toyota	Model	Rush
YOM	2022	Mileage	44,734
Registration No.	DAR3790	Chassis No.	MHKE8FF3PNK044903
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



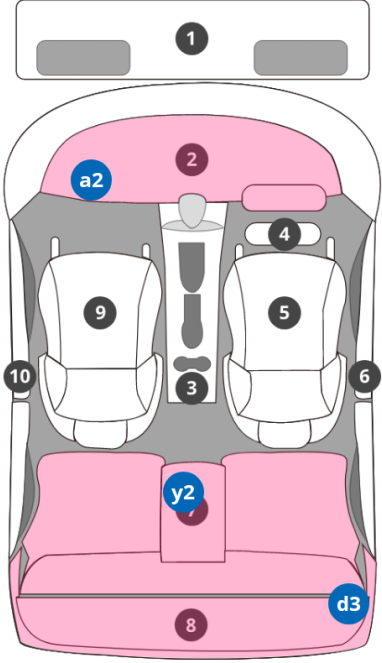
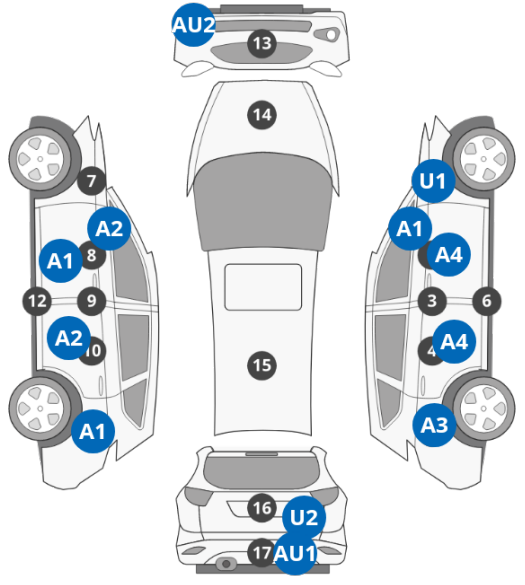
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.5	101	91	95
2	Boot Lid	87.9	87	88	89
3	Roof	89.4	83	86	100/89
4	Left Front Fender	97.7	101	97	95
5	Left Front Door	109.5	100	107	122
6	Center Panel Left				
7	Left Rear Door	105.6	112	102	103
8	Left Back Panel	96.3	107	93	90
9	Right Front Fender	100.6	100	101	101
10	Right Front Door	103.8	108	104	99
11	Center Panel Right				
12	Right Rear Door	101.1	97	96	110
13	Right Back Panel	99.6	95	97	107

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Steering Wheel - Worn, Peel, Crack - Small / Trunk Room - Loose, Deformed, Grime - Medium / Rear Seat - Grime - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Minimal / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Audio, Radio - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
radio not working. reverse camera not working. more scratches and dent around the exterior.