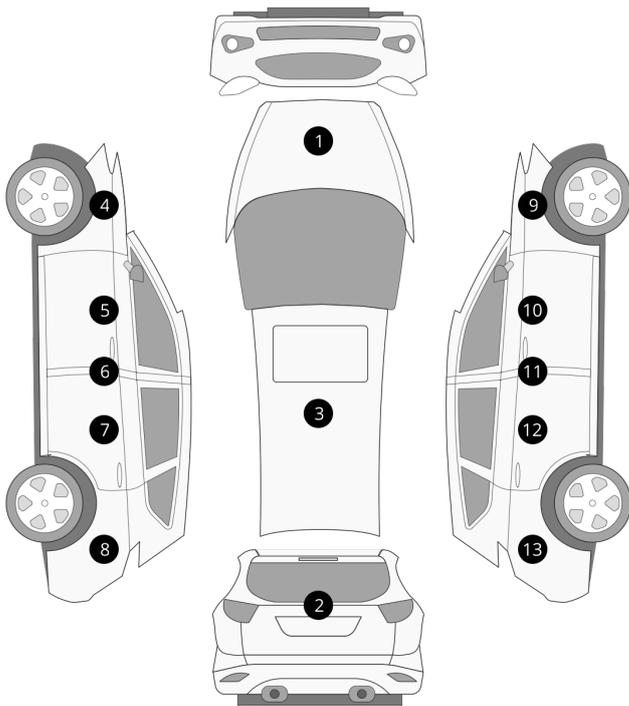


## General Information

Date & Time: 10, Mar, 2025 12:23

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Mileage</b>	31,521
<b>Registration No.</b>	NHI8203	<b>Chassis No.</b>	PA1B18F34P4212638
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



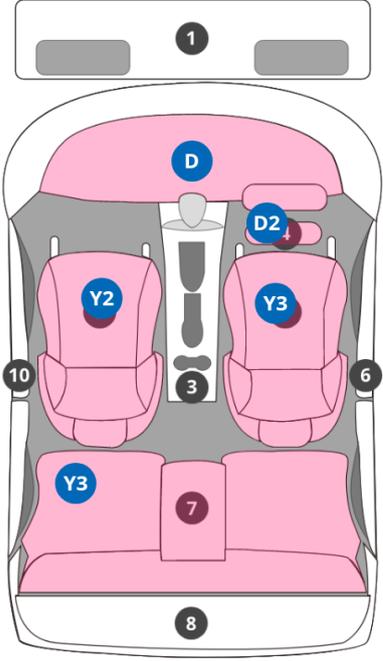
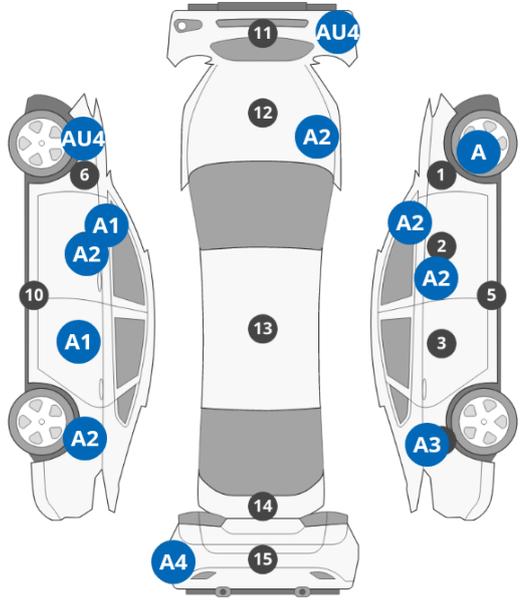
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	107	111	117
2	Boot Lid	110.3	103	116	112
3	Roof	102.3	106	96	109/99
4	Left Front Fender	92.7	97	93	88
5	Left Front Door	93.7	90	93	98
6	Center Panel Left				
7	Left Rear Door	91.7	93	92	91
8	Left Back Panel	103.3	103	103	104
9	Right Front Fender	93.5	91	92	97
10	Right Front Door	94.4	94	93	96
11	Center Panel Right				
12	Right Rear Door	102.3	100	102	105
13	Right Back Panel	101.8	105	99	102

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Dashboard - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small</p>	<p><b>Remarks</b> (L) Front Fender, Molding - Scratch &amp; Dent - Large / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / (R) Rear Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (L) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (R) Front Tyre - Crack, Cut - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet, spare tire, jack and tools. with LTO plate. worn front tires. front right tire flat.</p>