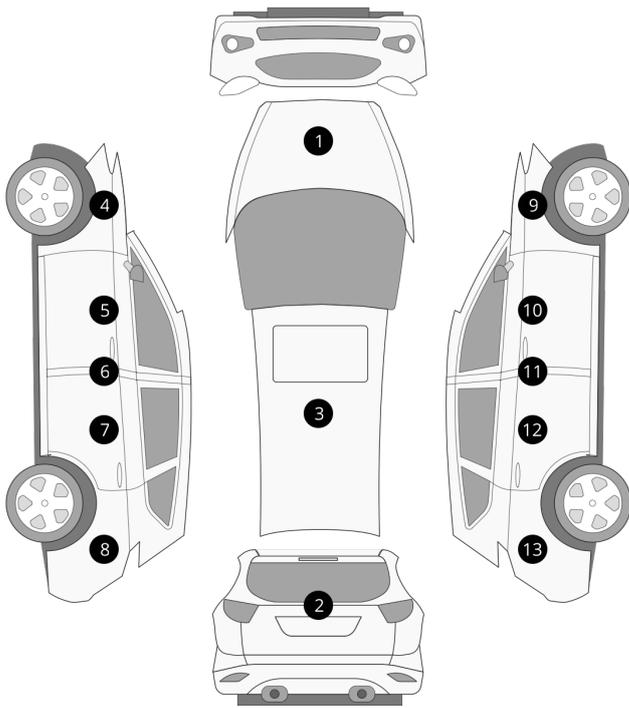


General Information

Date & Time: 17, Mar, 2025 13:22

Make	Toyota	Model	Hiace
YOM	2015	Mileage	89,991
Registration No.	ABL5958	Chassis No.	JS02P280049698
CC	2.5	Transmission	M/T
Fuel Type	Diesel	Type of Body	Van
Colour	White		

Body / Panel Condition



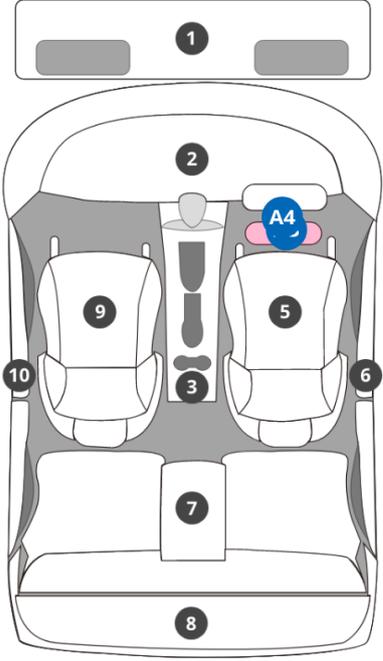
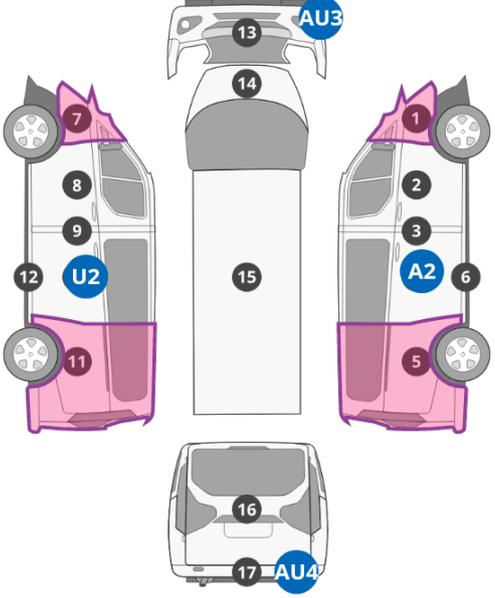
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	69.7	68	71	71
2	Boot Lid	214.6	172	328	144
3	Roof	70.4	64	67	75/75
4	Left Front Fender	174.3	180	166	177
5	Left Front Door	277.6	548	150	135
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	310.3	536	208	187
9	Right Front Fender	70.3	69	69	73
10	Right Front Door	124.6	126	131	117
11	Center Panel Right	145.6	141	157	139
12	Right Rear Door	235.0	312	179	214
13	Right Back Panel	204.6	192	236	186

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Carpet - Worn, Scratch, Cut, Crack - Medium / (L) Front Floor Mat - Cut, Crack - Large / Overall Interior - Worn as per age - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / Front Panel - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / (R) Center Panel - Repair Traces - Yes / Roof - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Wheel, Cover - Cap Missing - Yes / (L) Rear Wheel, Cover - Cap Missing - Yes / (R) Front Wheel, Cover - Cap Missing - Yes / (R) Rear Wheel, Cover - Cap Missing - Yes</p>
Frame Evaluation : B	Functional Evaluation : B
<p>Remarks Front Floor and Side Member - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate, Spare tire, jack, And Tools. No warranty booklet.</p>