

## General Information

Date & Time: 26, Mar, 2025 13:52

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Mileage</b>	51,063
<b>Registration No.</b>	DBB5480	<b>Chassis No.</b>	PA1B18F37N4196173
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



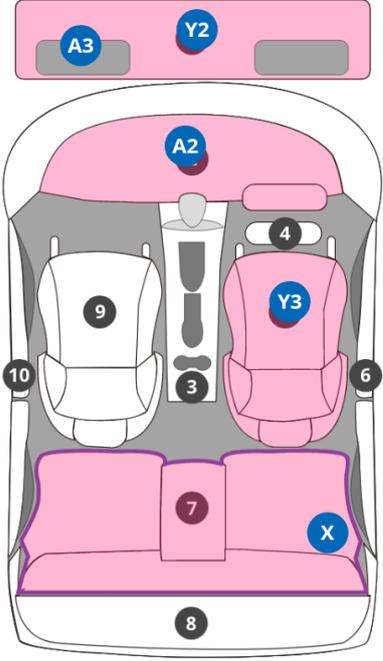
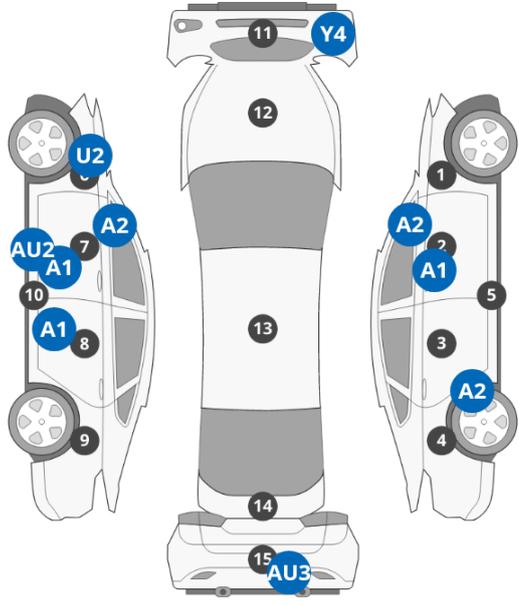
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	100.8	101	96	106
2	Boot Lid	106.0	97	119	102
3	Roof	101.1	90	87	95/133
4	Left Front Fender	116.0	110	126	112
5	Left Front Door	97.3	99	96	98
6	Center Panel Left				
7	Left Rear Door	105.3	104	104	108
8	Left Back Panel	112.0	109	126	101
9	Right Front Fender	94.2	97	97	89
10	Right Front Door	95.4	99	97	91
11	Center Panel Right				
12	Right Rear Door	95.9	92	95	101
13	Right Back Panel	93.8	89	93	100

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Sunvisor, Sunglass Holder - Cut, Crack - Medium / Rear Seat - Partially Missing - Yes</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Power Window (each) - Stuck, Gap - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>Possible flooding. Power window driver side malfunction. Interior lamp not working. Original car mats missing. Trunk cover missing. without warranty booklet. With Spare tire, jack and tools. Without LTO plate.</p>