

## General Information

Date & Time: 31, Mar, 2025 12:30

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Mileage</b>	13,963
<b>Registration No.</b>	DBM7904	<b>Chassis No.</b>	PA1B18F39R4246253
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red		

## Body / Panel Condition



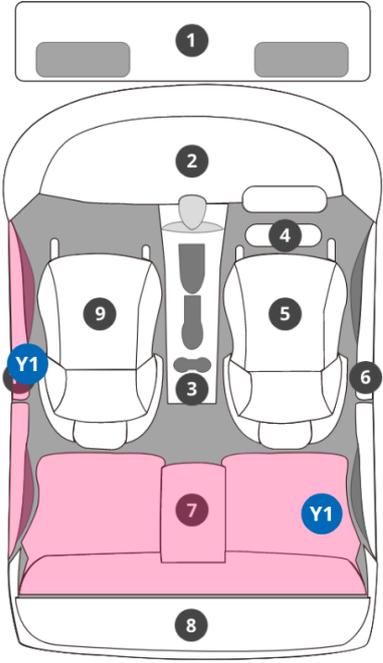
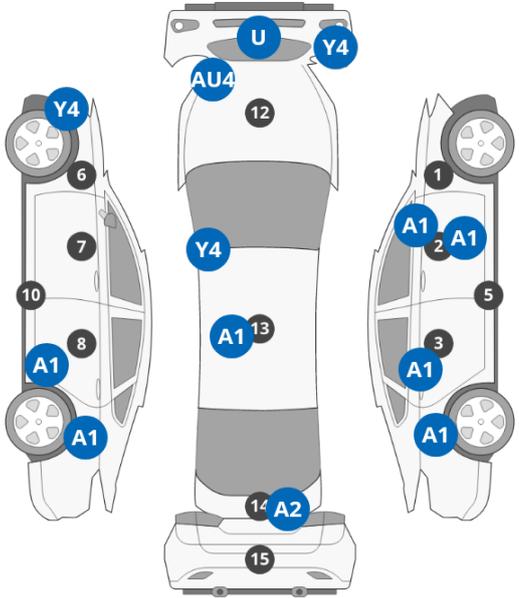
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	132	104	128
2	Boot Lid	112.6	129	102	107
3	Roof	118.7	126	111	112/126
4	Left Front Fender	98.8	98	98	100
5	Left Front Door	122.6	100	110	158
6	Center Panel Left				
7	Left Rear Door	107.3	108	105	109
8	Left Back Panel	146.6	190	115	135
9	Right Front Fender	110.6	113	109	110
10	Right Front Door	111.0	115	106	112
11	Center Panel Right				
12	Right Rear Door	115.9	117	99	132
13	Right Back Panel	117.3	123	105	124

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Minimal / (L) Front Trim - Grime - Minimal</p>	<p><b>Remarks</b> (L) Rear Fender - Repair Traces - Yes / Front Windshield - Damaged - Large / Bonnet, Headlight - Scratch &amp; Dent - Large / Member (Bolted) - Dent - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / Roof - Scratch - Minimal / Front Bumper, Grille, Lamps - Crack, Gap - Large / (L) Front Fender, Molding - Crack, Gap - Large</p>
<b>Frame Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">D</span>	<b>Functional Evaluation :</b> <span style="color: red; font-weight: bold; font-size: 1.2em;">A</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with jack and tools/with spare tire/with warranty booklet/cracked headlights/scratched tail lights</p>