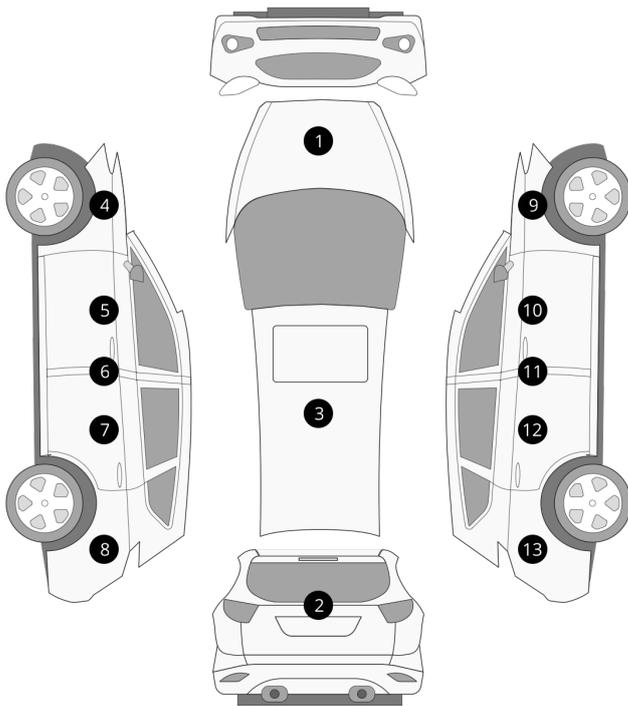


General Information

Date & Time: 28, Mar, 2025 12:41

| | | | |
|-------------------------|---------|---------------------|-------------------|
| Make | Toyota | Model | Vios |
| YOM | 2022 | Mileage | 98,146 |
| Registration No. | DAQ9683 | Chassis No. | PA1B18F32N4179166 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Sedan |
| Colour | Green | | |

Body / Panel Condition



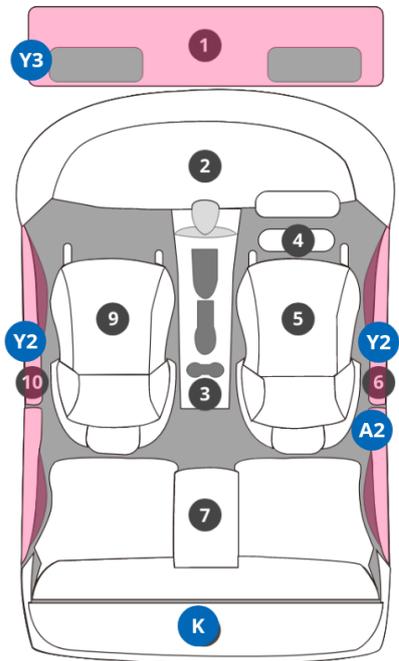
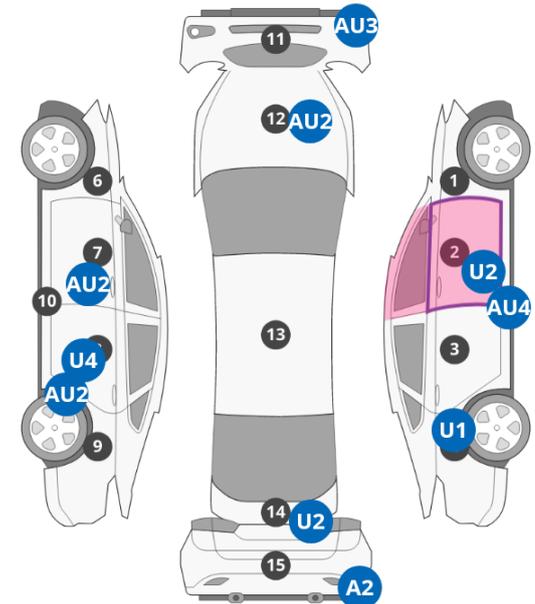
| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 109.3 | 110 | 105 | 113 |
| 2 | Boot Lid | 113.3 | 105 | 124 | 111 |
| 3 | Roof | 98.2 | 106 | 99 | 95/93 |
| 4 | Left Front Fender | 93.0 | 93 | 96 | 90 |
| 5 | Left Front Door | 121.0 | 113 | 119 | 131 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 283.0 | 325 | 230 | 294 |
| 8 | Left Back Panel | 245.6 | 244 | 318 | 175 |
| 9 | Right Front Fender | 129.0 | 113 | 138 | 136 |
| 10 | Right Front Door | 120.6 | 127 | 139 | 96 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 104.6 | 100 | 100 | 114 |
| 13 | Right Back Panel | 106.4 | 99 | 100 | 120 |

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

| | |
|--|---|
| Interior Evaluation : B | Exterior Evaluation : D |
|  <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> |  <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| Remarks (R) Rear Trim - Cut, Crack - Small / Overall Interior - Animal Hair - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / Ceiling - Grime - Medium | Remarks (R) Front Fender - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Front Door, Molding - Dent - Small / (R) Rear Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch & Dent - Small |
| Frame Evaluation : A | Functional Evaluation : C |
| Remarks Defects not found | Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist |

| |
|---|
| Inspector Notes |
| no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, weak battery, power steering issue due to weak battery, worn tires |