

## General Information

Date & Time: 28, Mar, 2025 12:46

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2024	<b>Mileage</b>	25,577
<b>Registration No.</b>	NHC9774	<b>Chassis No.</b>	PA1B18F34P4229889
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



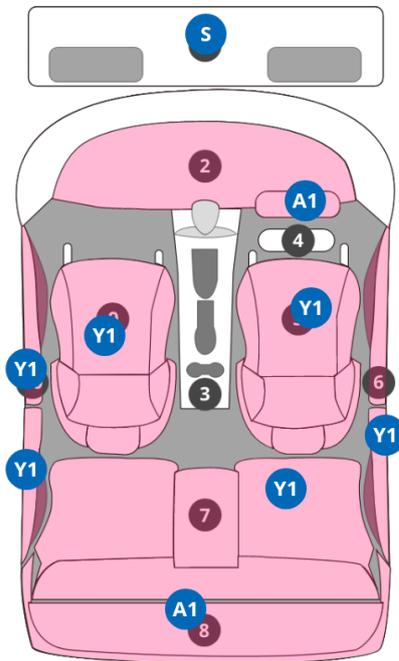
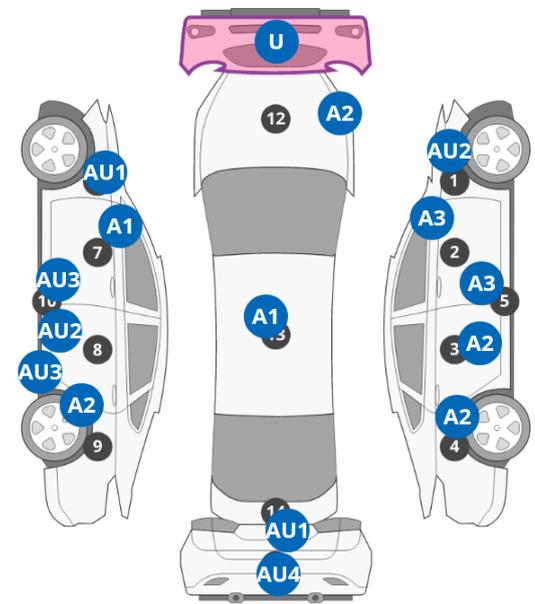
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	118	102	111
2	Boot Lid	99.3	93	100	105
3	Roof	87.9	90	89	84/89
4	Left Front Fender	99.1	96	94	108
5	Left Front Door	104.1	98	101	113
6	Center Panel Left				
7	Left Rear Door	102.6	99	97	112
8	Left Back Panel	106.5	119	100	101
9	Right Front Fender	94.8	97	91	97
10	Right Front Door	94.5	91	95	98
11	Center Panel Right				
12	Right Rear Door	126.4	126	156	97
13	Right Back Panel	119.8	110	99	150

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Minimal / Glove Box - Worn, Scratch, Cut, Crack - Minimal / (R) Rear Trim - Grime - Minimal / Trunk Room - Worn, Scratch, Cut, Crack - Minimal / Rear Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / (L) Rear Trim - Grime - Minimal / (L) Front Seat - Grime - Minimal / Overall Interior - Smell - Yes</p>	<p><b>Remarks</b> (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Mirror - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Large / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch &amp; Dent - Small / (L) Front Door, Molding - Scratch &amp; Dent - Medium / (L) Mirror - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>With LTO plate/no warranty booklet/with tools and jack/with spare tire/loosed left cheek light/paint splatter on right rear fender</p>