

General Information

Date & Time: 09, Apr, 2025 15:45

Make	Toyota	Model	Vios
YOM	2022	Mileage	106,014
Registration No.	NFK8501	Chassis No.	PA1B18F39N4171307
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



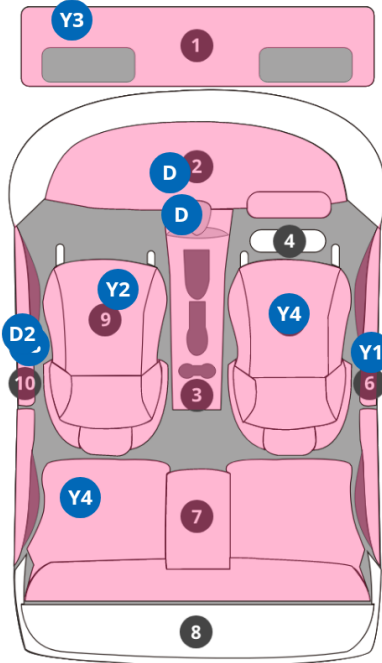
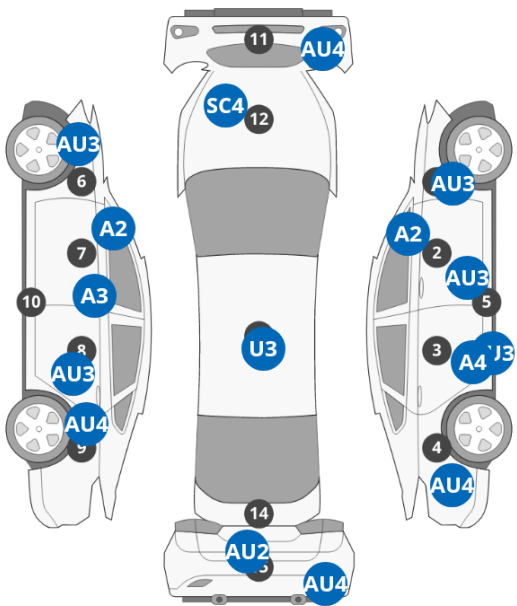
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.0	106	107	114
2	Boot Lid	90.9	87	89	97
3	Roof	99.3	104	101	87/105
4	Left Front Fender	200.0	201	246	153
5	Left Front Door	88.9	89	86	92
6	Center Panel Left				
7	Left Rear Door	134.3	151	143	109
8	Left Back Panel	179.0	240	154	143
9	Right Front Fender	85.7	83	92	82
10	Right Front Door	213.0	283	235	121
11	Center Panel Right				
12	Right Rear Door	275.3	127	341	358
13	Right Back Panel	172.1	83	206	227

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Medium / (L) Front Trim - Worked - Small / Rear Seat - Grime - Large / Console, Switchs, Vents - Traces of Adhesive Tape - Yes / Dashboard - Traces of Adhesive Tape - Yes / Overall Interior - Worn as per age - Yes / Ceiling - Grime - Medium / (L) Front Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Mirror - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Front Fender, Molding - Scratch & Dent - Medium / Bonnet, Headlight - Rust, Corrosion - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Dent - Medium
Frame Evaluation : B	Functional Evaluation : B
Remarks Left Tyre House - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, plate light issue