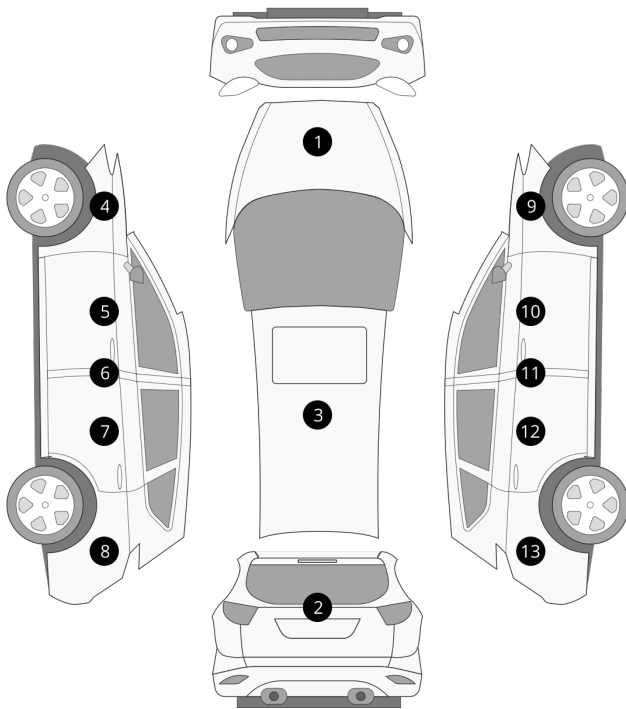


General Information

Date & Time: 23, Apr, 2025 08:35

Make	Toyota	Model	Vios
YOM	2024	Mileage	10,320
Registration No.	NFR6005	Chassis No.	PA1B18F3XR4252659
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



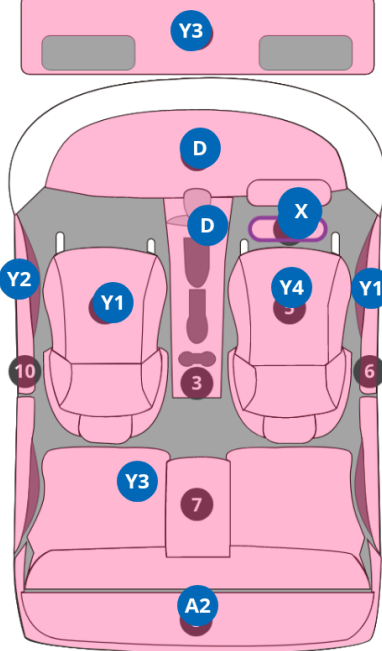
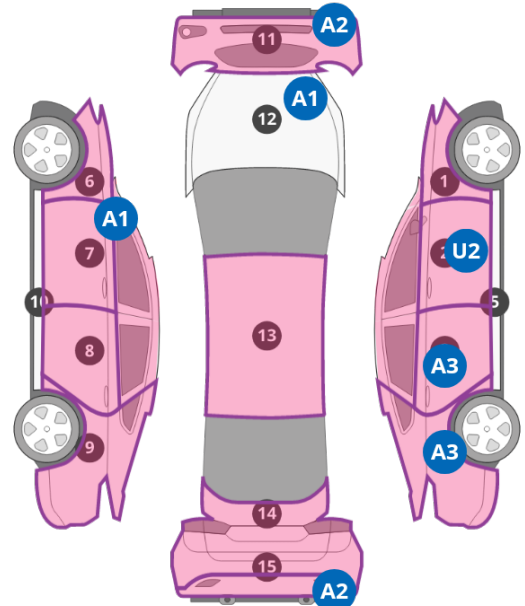
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.0	113	114	103
2	Boot Lid	100.3	99	100	102
3	Roof	95.9	103	93	89/99
4	Left Front Fender	99.3	96	103	100
5	Left Front Door	100.2	101	101	99
6	Center Panel Left				
7	Left Rear Door	103.6	118	102	91
8	Left Back Panel	101.0	108	100	96
9	Right Front Fender	96.3	100	92	97
10	Right Front Door	101.2	104	98	102
11	Center Panel Right				
12	Right Rear Door	104.8	105	98	111
13	Right Back Panel	103.2	100	100	110

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Minimal / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Minimal / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Small / Ceiling - Grime - Medium	Remarks (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Repair mark - Yes / Roof - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
No spare tire/No LTO plate/No jack and tools/No warranty booklet/repair marks around the vehicle/possible flooding