

General Information

Date & Time: 10, Apr, 2025 11:05

Make	Toyota	Model	Innova
YOM	2024	Mileage	19,134
Registration No.	NKI6923	Chassis No.	PA2JA8EM7R0142340
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	MPV
Colour	Silver		

Body / Panel Condition



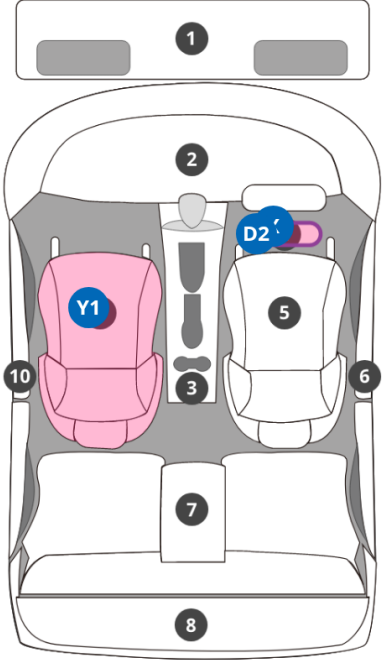
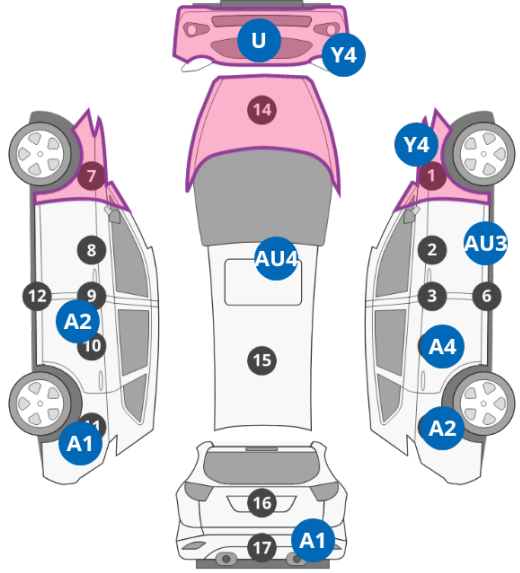
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	338.0	127	133	754
2	Boot Lid	89.5	92	86	90
3	Roof	92.1	103	90	89/87
4	Left Front Fender	677.0	229	1,044	758
5	Left Front Door	92.0	91	91	94
6	Center Panel Left				
7	Left Rear Door	92.2	97	95	85
8	Left Back Panel	82.4	81	85	81
9	Right Front Fender	97.7	92	99	102
10	Right Front Door	88.1	87	89	88
11	Center Panel Right				
12	Right Rear Door	93.3	89	94	97
13	Right Back Panel	94.4	93	94	97

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Mat Other - Missing - Yes / (L) Front Seat - Grime - Minimal / (L) Front Floor Mat - Worked - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Roof - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Crack, Gap - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / (R) Rear Door, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes

Inspector Notes
with LTO plate and warranty booklet, Jack, Spare tire and incomplete tools. crack on headlights , scratches on tail lights.