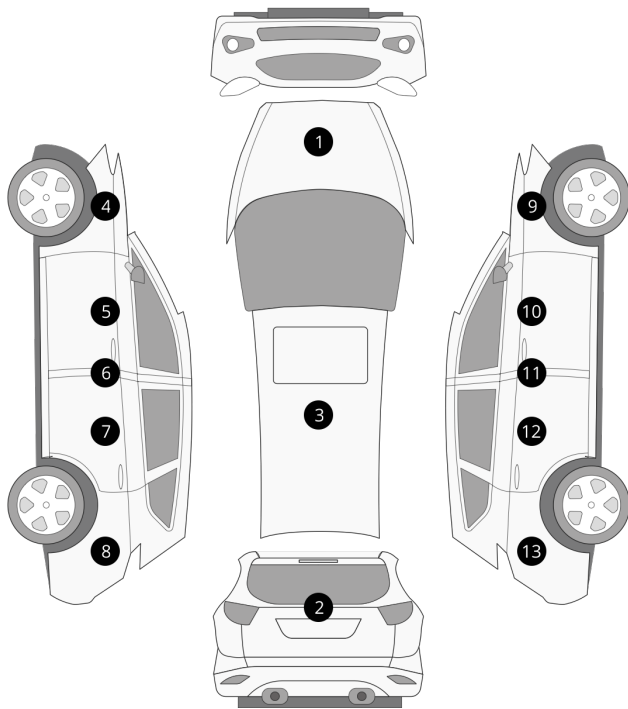


General Information

Date & Time: 30, Jun, 2025 17:10

Make	Toyota	Model	Veloz
YOM	2024	Odo Meter Reading	24,067
Registration No.	NHM5031	Chassis No.	MHFAB1BYXP3082324
CC	1.5	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	White		

Body / Panel Condition



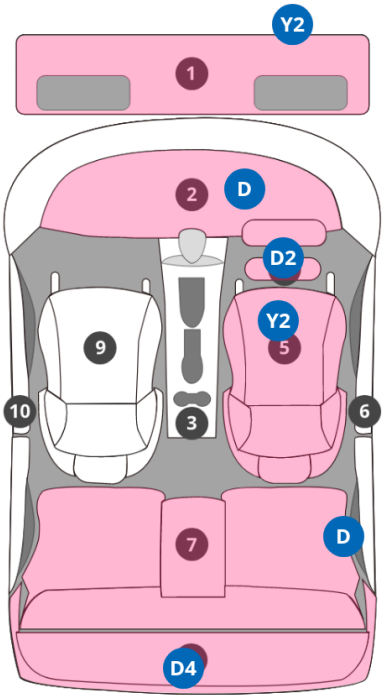
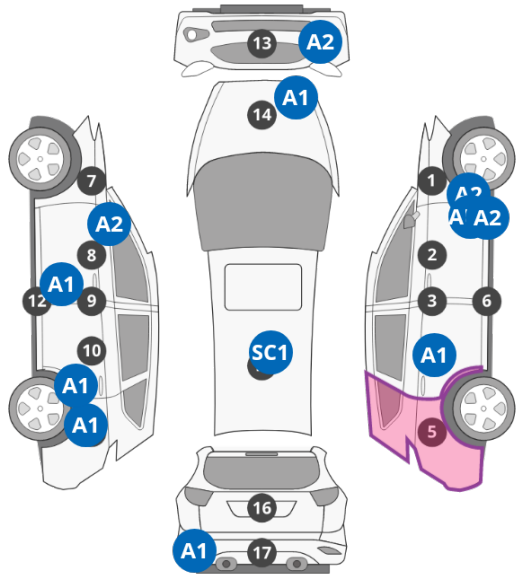
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	118.6	120	110	126
2	Boot Lid	118.6	135	121	100
3	Roof	137.2	151	147	123/128
4	Left Front Fender	121.6	123	122	120
5	Left Front Door	134.0	133	133	136
6	Center Panel Left				
7	Left Rear Door	124.3	131	117	125
8	Left Back Panel	154.0	161	143	158
9	Right Front Fender	117.3	116	121	115
10	Right Front Door	127.6	140	120	123
11	Center Panel Right				
12	Right Rear Door	122.6	119	114	135
13	Right Back Panel	140.6	140	134	148

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Trunk Room - Worked - Large / Rear Seat - Worn - Yes / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Rear Fender, Molding - Partially Missing - Yes / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Scratch - Minimal / Roof - Rust, Corrosion - Minimal
Frame Evaluation : A	Functional Evaluation : D
Remarks Defects not found	Remarks Panel, Meter - Issue - Yes / Shift Shock - Function - Weak / Reverse Camera - N/A - Yes / Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes

no warranty booklet, no jack and tools, with spare tire, with LTO plate, shift shock issue, turn signal/hazard flasher issue, plate light issue, reverse indicator issue, PMS indicator on