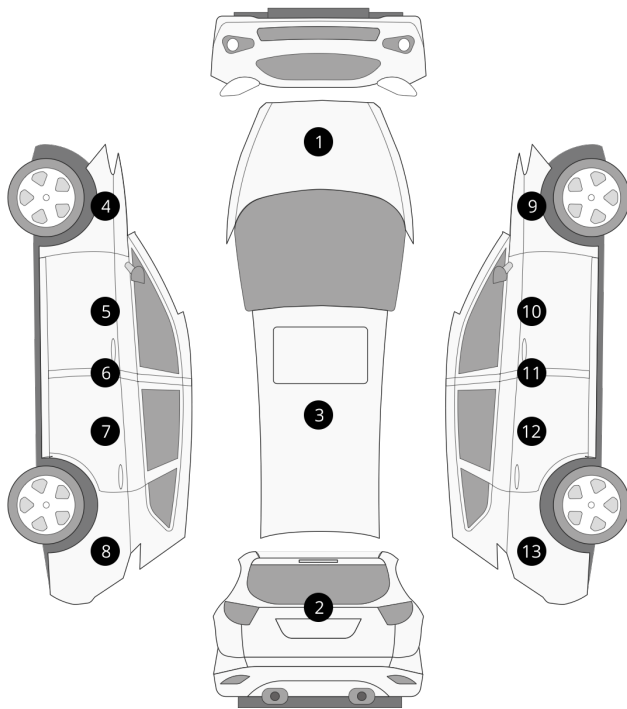


General Information

Date & Time: 28, Apr, 2025 12:31

Make	Toyota	Model	Wigo
YOM	2023	Mileage	17,061
Registration No.	EAF5059	Chassis No.	MHKA4DF5FNJ072718
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



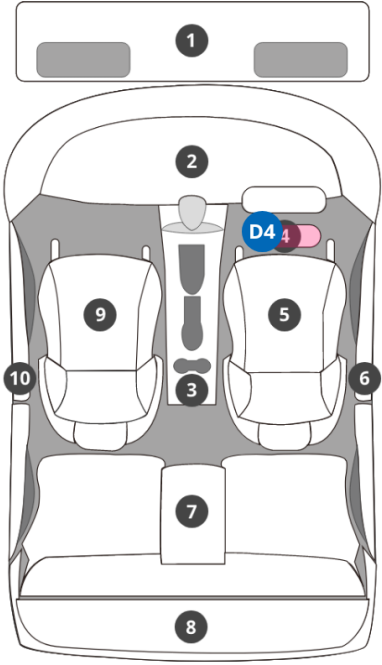
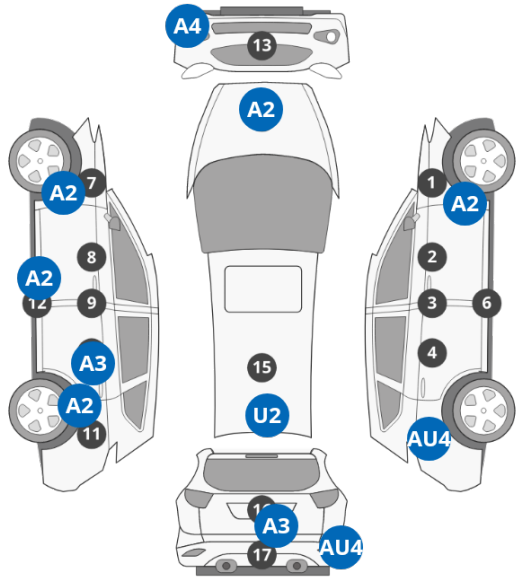
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	139.3	140	144	134
2	Boot Lid	151.6	148	161	146
3	Roof	127.2	116	138	123/132
4	Left Front Fender	134.6	127	139	138
5	Left Front Door	125.6	129	127	121
6	Center Panel Left				
7	Left Rear Door	130.0	133	122	135
8	Left Back Panel	125.6	133	126	118
9	Right Front Fender	143.6	148	147	136
10	Right Front Door	148.3	151	146	148
11	Center Panel Right				
12	Right Rear Door	132.6	133	130	135
13	Right Back Panel	146.0	150	142	146

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Large	Remarks (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Roof Spoiler, Molding - Dent - Small / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
tail light cracked/ no tools and jack/ with spare tire and LTO plate/ with warranty booklet/