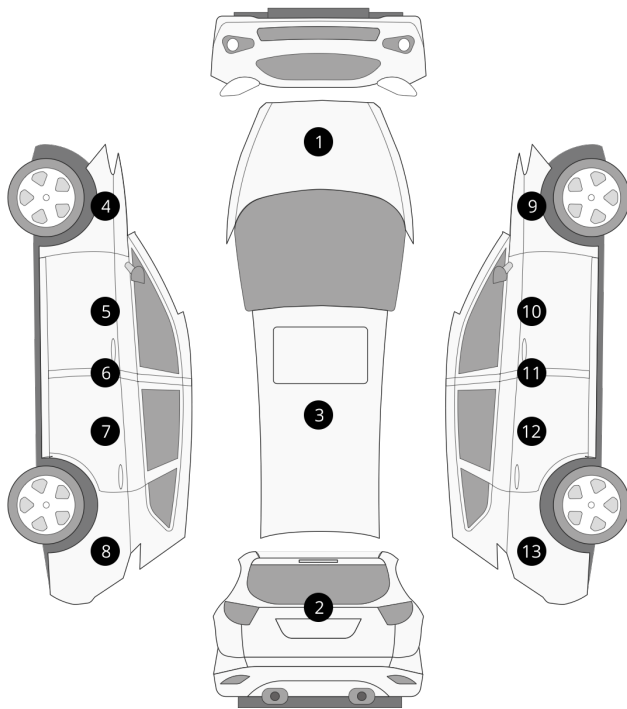


General Information

Date & Time: 28, Apr, 2025 13:58

Make	Toyota	Model	Vios
YOM	2024	Mileage	33,248
Registration No.	DBM2592	Chassis No.	PA1B18F38R4239988
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



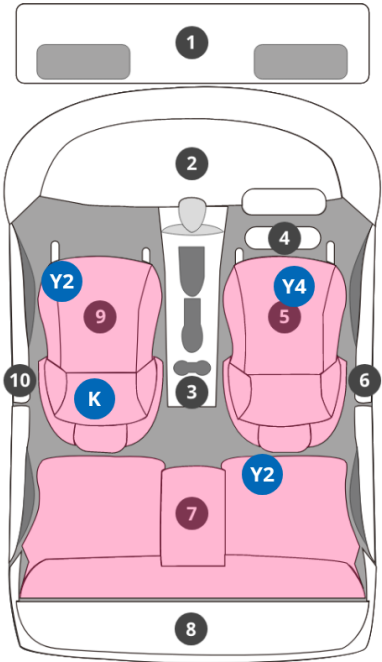
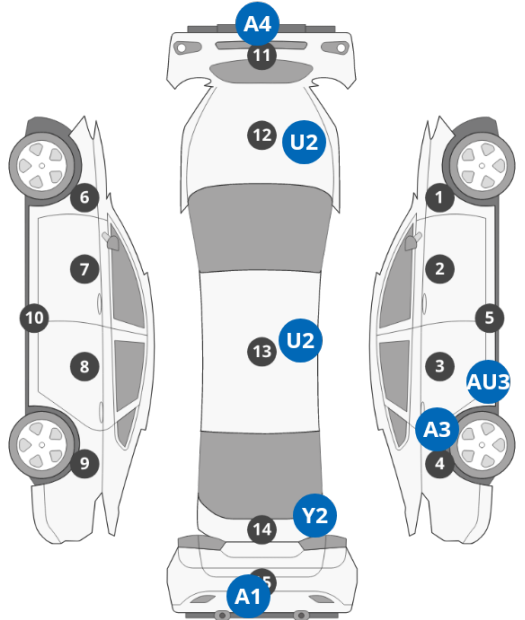
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	97.3	107	81	104
2	Boot Lid	102.9	95	105	109
3	Roof	92.6	98	88	100/85
4	Left Front Fender	88.2	94	86	85
5	Left Front Door	90.1	88	91	91
6	Center Panel Left				
7	Left Rear Door	97.6	100	96	97
8	Left Back Panel	101.2	105	106	93
9	Right Front Fender	91.9	92	90	94
10	Right Front Door	100.7	90	111	101
11	Center Panel Right				
12	Right Rear Door	90.5	86	92	94
13	Right Back Panel	100.5	97	100	105

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / (L) Front Seat - Grime - Small / Overall Interior - Animal Hair - Yes / Rear Seat - Grime - Small	Remarks Bonnet, Headlight - Dent - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Roof - Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Crack, Gap - Small
Frame Evaluation : B	Functional Evaluation : C
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Spare Key - Issue - Unexist

Inspector Notes
paint cement splatter on the vehicle/ worn tires / incomplete tools/ with jack and spare tire/ with LTO plate/ power steering issue due to weak battery / slight bending o the front cross member support