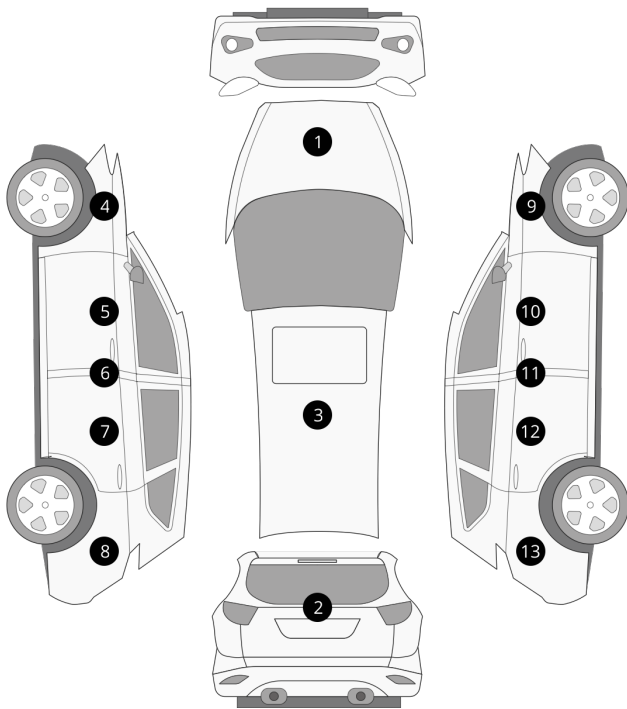


General Information

Date & Time: 28, Apr, 2025 13:14

Make	Toyota	Model	Wigo
YOM	2021	Mileage	52,854
Registration No.	NEP3362	Chassis No.	MHKA4DF5FLJ049598
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Black		

Body / Panel Condition



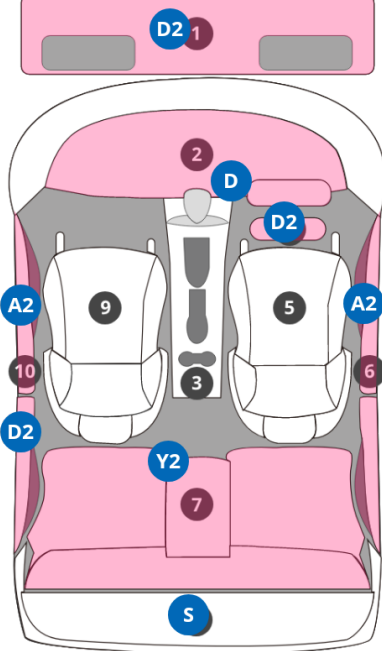
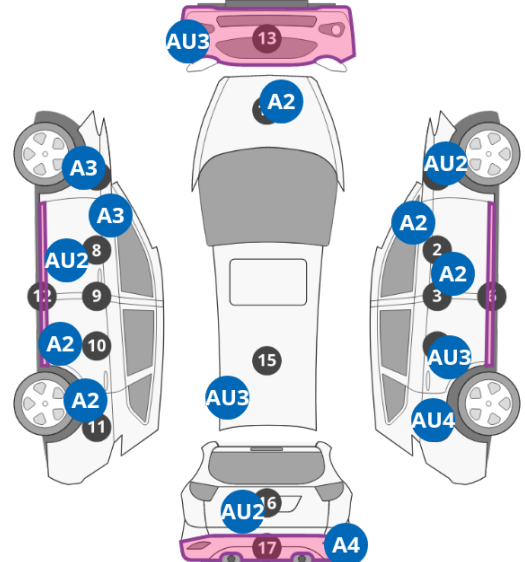
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	82.9	80	90	80
2	Boot Lid	300.3	362	376	163
3	Roof	68.1	61	74	68/70
4	Left Front Fender	86.1	74	86	99
5	Left Front Door	82.1	80	84	83
6	Center Panel Left				
7	Left Rear Door	86.6	92	86	82
8	Left Back Panel	113.6	112	116	113
9	Right Front Fender	80.3	88	79	74
10	Right Front Door	72.2	77	76	64
11	Center Panel Right				
12	Right Rear Door	119.3	139	116	103
13	Right Back Panel	177.3	189	178	165

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Small / (R) Front Trim - Cut, Crack - Small / (L) Rear Trim - Crinkle - Small / (L) Front Trim - Cut, Crack - Small / Overall Interior - Worn as per age - Yes / (L) Front Floor Mat - Worked - Small / Overall Interior - Smell - Yes / Ceiling - Crinkle - Small / Dashboard - Traces of Adhesive Tape - Yes	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Rear End Panel - Replaced - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / (R) Step, In-panel, Side Spoiler - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Small / Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Medium / (L) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Small / Roof - Scratch & Dent - Medium
Frame Evaluation : D	Functional Evaluation : A
Remarks Rear Side Member & Trunk Room Floor - Traces of Bending, or Marks of Panel Repair ? - Yes / Under Spare Box - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Rear Side Member & Trunk Room Floor - Condition of Welding, Hardness and Shape of Sealant ? - Yes	Remarks Remote Key & Smart entry - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratches on tail light, reverse light issue, loose rear seat