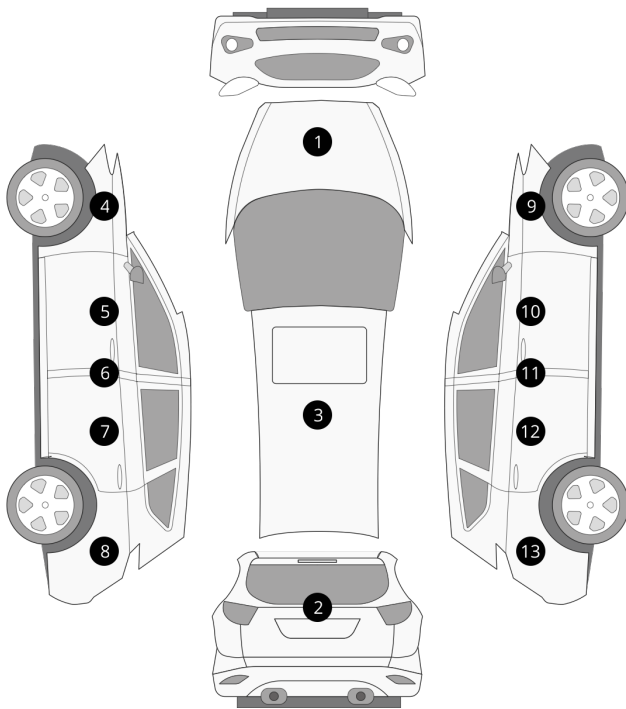


General Information

Date & Time: 30, Apr, 2025 08:50

Make	Toyota	Model	Vios
YOM	2023	Mileage	55,089
Registration No.	NIH1396	Chassis No.	PA1B18F32N4199501
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



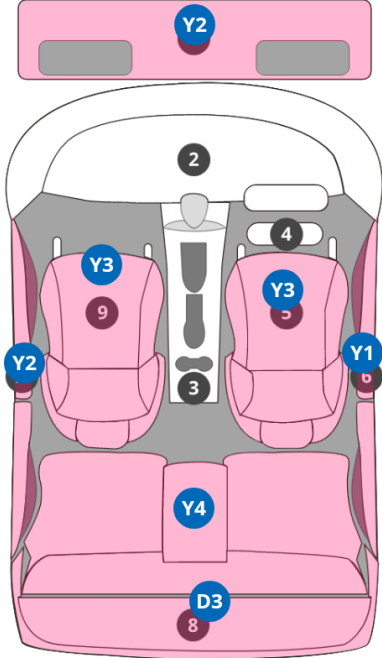
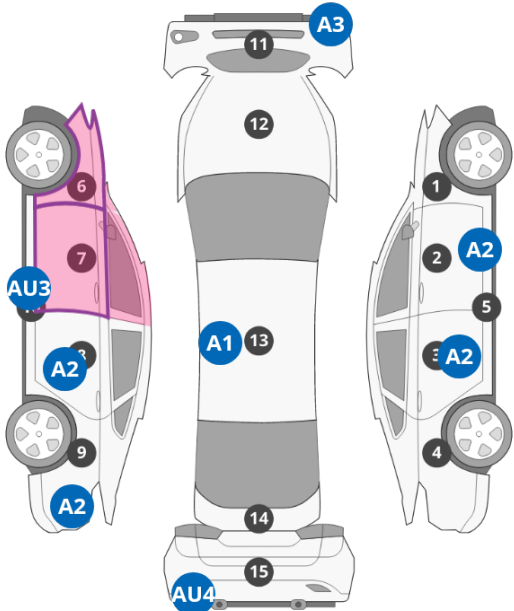
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	129.0	133	128	126
2	Boot Lid	98.7	93	97	106
3	Roof	92.0	98	85	89/97
4	Left Front Fender	172.6	162	171	185
5	Left Front Door	173.6	193	196	132
6	Center Panel Left				
7	Left Rear Door	190.6	236	158	178
8	Left Back Panel	206.3	205	277	137
9	Right Front Fender	89.1	89	87	92
10	Right Front Door	104.1	90	98	125
11	Center Panel Right				
12	Right Rear Door	93.7	86	100	96
13	Right Back Panel	88.8	89	83	95

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Large / (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / Trunk Room - Loose, Deformed - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Small	Remarks (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Repair mark - Yes / Roof - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small
Frame Evaluation : D	Functional Evaluation : D
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Pillar - Condition of Welding ? - Yes	Remarks Retractable Mirror - Issue - Yes / Warning Lamps - Issue - Yes / Power Window (each) - Stuck, Gap - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with LTO plate, no warranty booklet, with jack, Incomplete tools, with spare tire, discoloration on headlight and tail light, cracked tail light and headlight, power window issue, no reverse cam