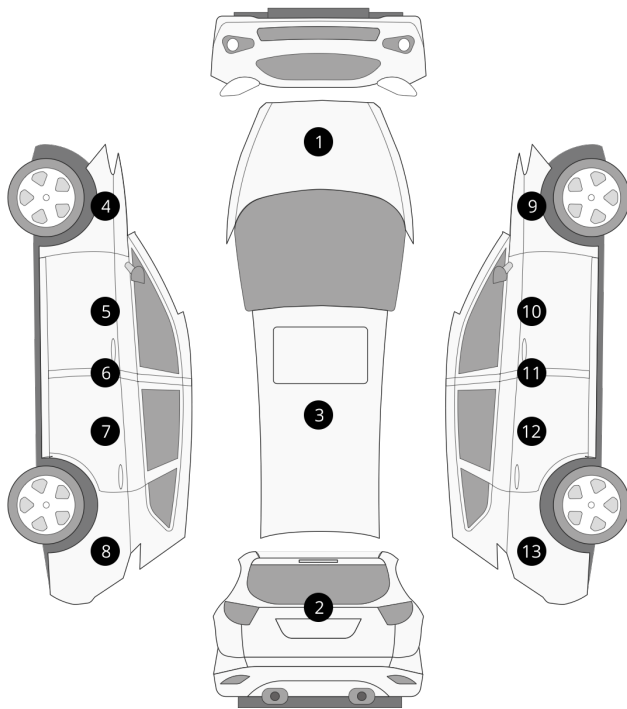


General Information

Date & Time: 23, Apr, 2025 11:22

Make	Toyota	Model	Vios
YOM	2024	Mileage	22,682
Registration No.	NHR7846	Chassis No.	PA1B18F34P4231447
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



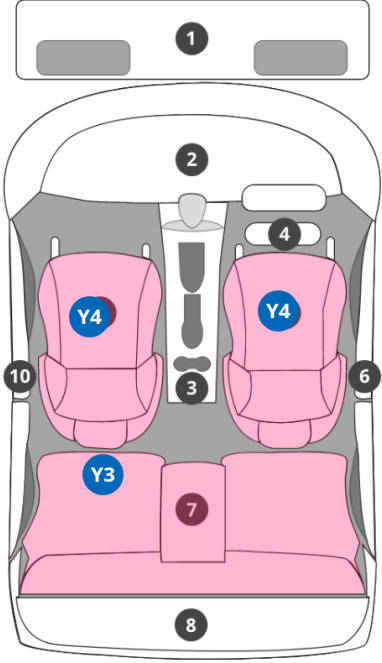
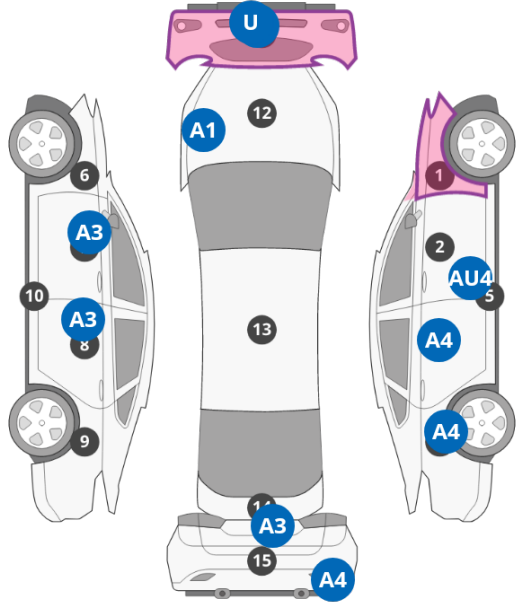
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	92.0	89	89	98
2	Boot Lid	95.3	95	92	99
3	Roof	83.1	82	83	83/84
4	Left Front Fender	84.5	87	82	84
5	Left Front Door	89.7	91	86	93
6	Center Panel Left				
7	Left Rear Door	88.0	94	83	87
8	Left Back Panel	94.3	95	96	92
9	Right Front Fender	212.6	281	195	162
10	Right Front Door	93.5	97	92	92
11	Center Panel Right				
12	Right Rear Door	90.0	88	90	92
13	Right Back Panel	95.5	94	86	107

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Large / (R) Front Seat - Grime - Large / Rear Seat - Grime - Medium	Remarks (R) Front Fender - Repair Traces - Yes / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Front Bumper, Grille, Lamps - Dent - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Minimal / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes

with warranty booklet/with LTO plate/ with jack and spare tire/ incomplete tools/