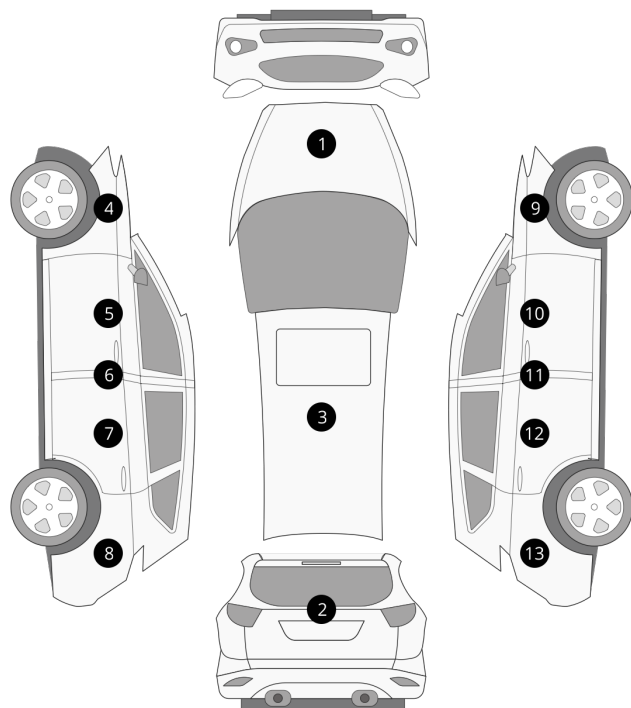


General Information

Date & Time: 23, Apr, 2025 16:58

Make	Toyota	Model	Vios
YOM	2024	Mileage	27,530
Registration No.	NFR3028	Chassis No.	PA1B18F36R4247572
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



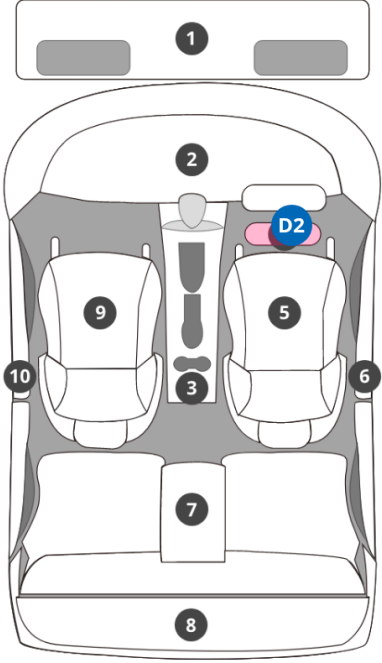
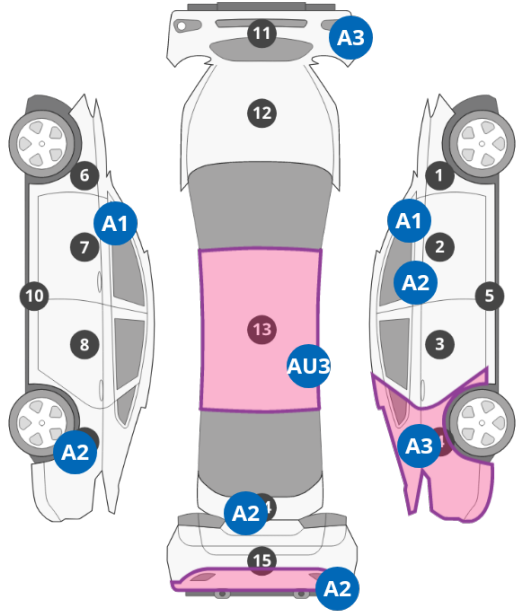
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.3	100	97	101
2	Boot Lid	96.9	92	101	98
3	Roof	91.0	100	90	86/88
4	Left Front Fender	198.6	198	245	153
5	Left Front Door	87.8	86	89	89
6	Center Panel Left				
7	Left Rear Door	89.8	95	90	85
8	Left Back Panel	97.3	106	96	91
9	Right Front Fender	89.3	90	87	91
10	Right Front Door	88.0	87	87	91
11	Center Panel Right				
12	Right Rear Door	88.5	81	87	97
13	Right Back Panel	87.6	88	89	86

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Floor Mat - Worked - Small	Remarks (L) Front Fender - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Repair mark - Yes / Roof - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch & Dent - Medium
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes

Inspector Notes
with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate