

General Information

Date & Time: 29, Apr, 2025 09:06

Make	Toyota	Model	Vios
YOM	2024	Mileage	26,065
Registration No.	DBN7260	Chassis No.	PA1B18F3XP4234675
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



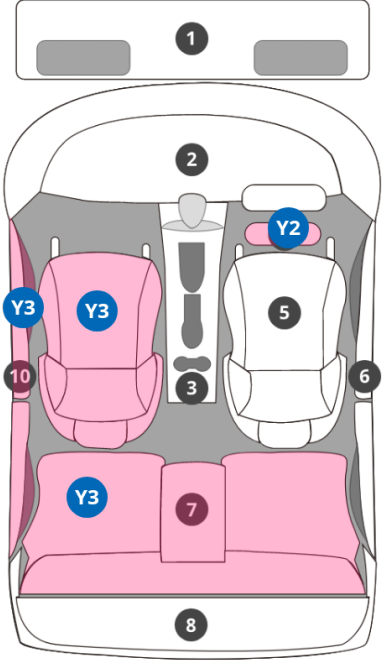
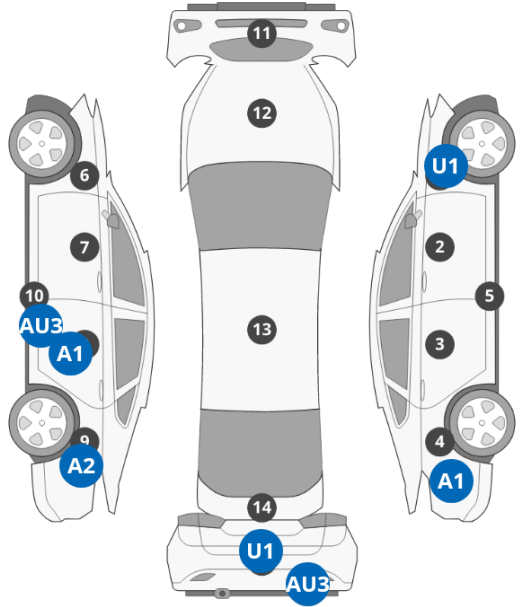
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.8	101	90	97
2	Boot Lid	92.6	87	93	98
3	Roof	83.1	81	81	84/86
4	Left Front Fender	98.7	101	100	95
5	Left Front Door	116.6	123	109	118
6	Center Panel Left				
7	Left Rear Door	86.1	85	85	89
8	Left Back Panel	94.3	104	92	87
9	Right Front Fender	89.2	89	86	93
10	Right Front Door	87.0	95	84	82
11	Center Panel Right				
12	Right Rear Door	84.7	82	85	87
13	Right Back Panel	91.7	90	86	100

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : B
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Medium	Remarks (L) Front Fender - Repair Traces - Yes / (R) Front Fender, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
with LTO plate/with spare tire/with jack/with warranty booklet/No tools/reverse camera not working