

## General Information

Date & Time: 04, Jun, 2025 13:46

<b>Make</b>	Toyota	<b>Model</b>	Raize
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	28,943
<b>Registration No.</b>	YAB5578	<b>Chassis No.</b>	MHKAB1BA9PJ061903
<b>CC</b>	1.2	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	SUV
<b>Colour</b>	Silver		

## Body / Panel Condition



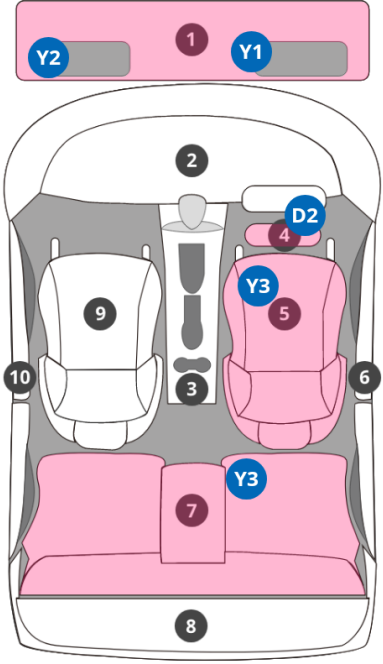
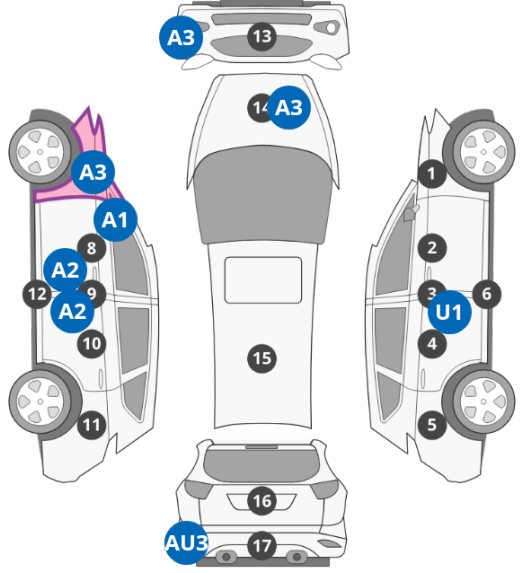
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.6	102	120	107
2	Boot Lid	82.1	80	90	77
3	Roof	107.1	109	119	103/98
4	Left Front Fender	88.7	88	90	88
5	Left Front Door	96.2	95	98	95
6	Center Panel Left				
7	Left Rear Door	87.9	88	93	83
8	Left Back Panel	90.6	85	91	97
9	Right Front Fender	133.6	127	134	140
10	Right Front Door	187.0	184	188	189
11	Center Panel Right				
12	Right Rear Door	89.5	87	89	93
13	Right Back Panel	80.9	78	85	80

## Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / Sunvisor, Sunglass Holder - Grime - Small / Ceiling - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Rear Door, Molding - Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate</p>