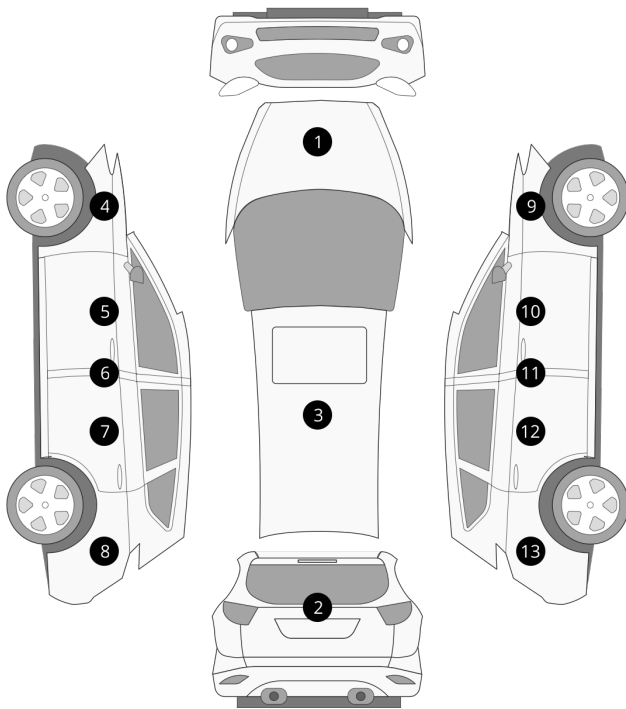


General Information

Date & Time: 28, Apr, 2025 18:55

Make	Toyota	Model	Vios
YOM	2022	Mileage	67,463
Registration No.	EAE7803	Chassis No.	PA1B18F39M4166462
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



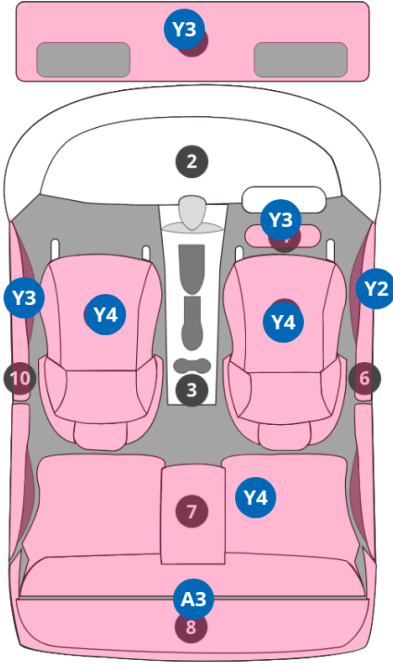
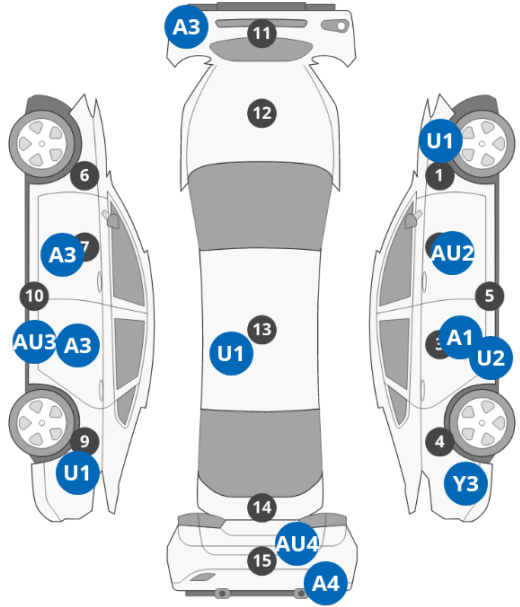
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	90.5	92	89	90
2	Boot Lid	118.7	91	100	165
3	Roof	80.5	83	74	82/84
4	Left Front Fender	81.5	80	83	82
5	Left Front Door	84.7	85	87	82
6	Center Panel Left				
7	Left Rear Door	87.3	91	88	83
8	Left Back Panel	93.0	91	90	98
9	Right Front Fender	82.8	85	83	81
10	Right Front Door	86.0	81	91	86
11	Center Panel Right				
12	Right Rear Door	80.6	78	79	85
13	Right Back Panel	87.2	82	84	96

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / Trunk Room - Worn, Scratch, Cut, Crack - Medium / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Medium / (L) Front Trim - Grime - Medium	Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Step, In-panel, Side Spoiler - Dent - Small / (R) Rear Fender, Molding - Crack, Gap - Medium / (R) Front Door, Molding - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Fender, Molding - Dent - Minimal / Roof - Dent - Minimal / (R) Front Fender, Molding - Dent - Minimal
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire/with warranty booklet/No jack and tools/reverse camera not working/possible flooding/left side mirror issue