

General Information

Date & Time: 30, Apr, 2025 08:20

Make	Ford	Model	Everest
YOM	2018	Mileage	55,819
Registration No.	CAK6006	Chassis No.	MNCAXXMAWAJY02175
CC	2.2	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Red		

Body / Panel Condition



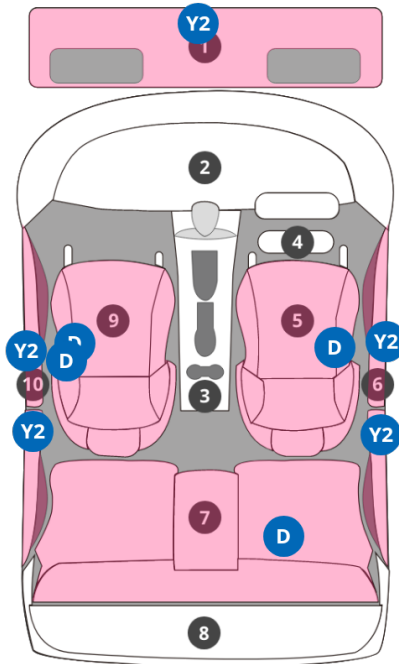

#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	84.9	89	82	83
2	Boot Lid	239.0	284	256	177
3	Roof	95.6	93	92	97/100
4	Left Front Fender	90.5	82	92	99
5	Left Front Door	131.0	137	123	133
6	Center Panel Left				
7	Left Rear Door	210.6	208	193	231
8	Left Back Panel	272.0	376	223	217
9	Right Front Fender	221.0	184	265	214
10	Right Front Door	98.5	98	94	104
11	Center Panel Right				
12	Right Rear Door	170.3	226	183	102
13	Right Back Panel	94.5	87	94	103

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
<div style="text-align: center;">  </div> <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<div style="text-align: center;">  </div> <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (R) Rear Trim - Grime - Small / Rear Seat - Worn - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Rear Trim - Grime - Small / (L) Front Seat - Repair Mark - Yes / Ceiling - Grime - Small / Overall Interior - Worn as per age - Yes</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Mirror - Crack - Cracks / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Center Floor Panel - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes / Under Spare Box - Bulge (Cuts, Major Deforms) or Corrosion ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light, suncrack headlights, plate light issue, hood issue</p>