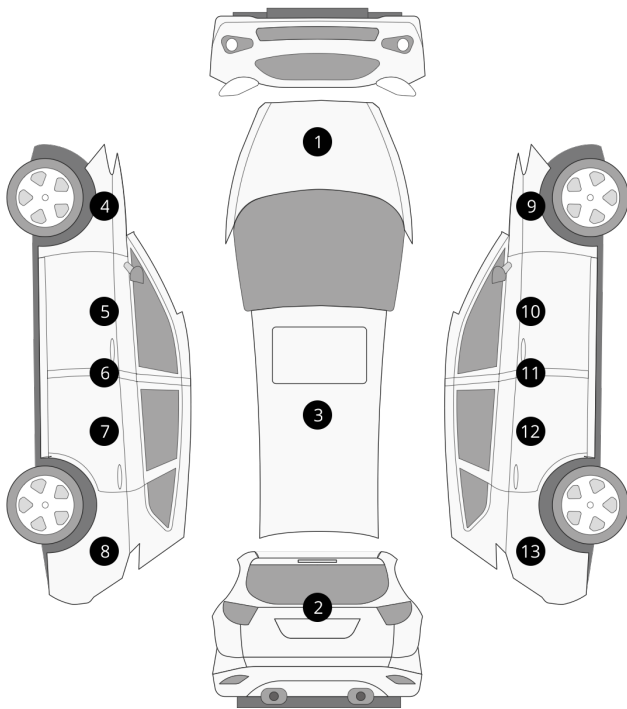


General Information

Date & Time: 30, Apr, 2025 08:22

Make	Mitsubishi	Model	Xpander
YOM	2019	Mileage	82,111
Registration No.	NEF5610	Chassis No.	MK2XRNC1WKN078285
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



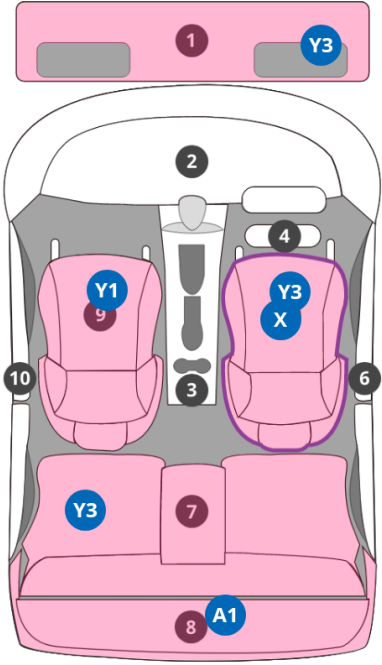
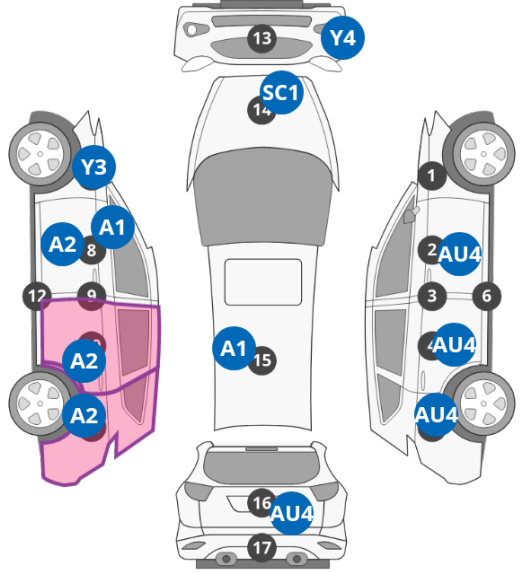
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	86.2	86	80	93
2	Boot Lid	88.7	90	87	89
3	Roof	98.4	111	96	94/93
4	Left Front Fender	80.2	85	83	73
5	Left Front Door	89.6	92	90	87
6	Center Panel Left				
7	Left Rear Door	190.3	225	169	177
8	Left Back Panel	177.0	177	181	173
9	Right Front Fender	83.3	84	88	79
10	Right Front Door	87.0	86	85	91
11	Center Panel Right				
12	Right Rear Door	84.3	87	85	82
13	Right Back Panel	130.6	135	133	124

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat Head Rest - Missing - Yes / Ceiling - Grime - Medium / (L) Front Seat - Grime - Minimal / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Minimal	Remarks (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Rust, Corrosion - Minimal / (L) Mirror - Scratch, Peeled - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Roof - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Crack, Gap - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Turn Signal, Hazard Flasher - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes

Inspector Notes
WITH LTO PLATE AND WARRANTY BOOKLET NO TOOLS AND SPARETIRE, SIGNAL LIGHT ISSUE, WORN TIRES, PLATE LIGHT ISSUE