

## General Information

Date & Time: 02, May, 2025 08:57

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Mileage</b>	28,521
<b>Registration No.</b>	NFP5709	<b>Chassis No.</b>	PA1B18F35N4192896
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Red Mica Metallic		

## Body / Panel Condition



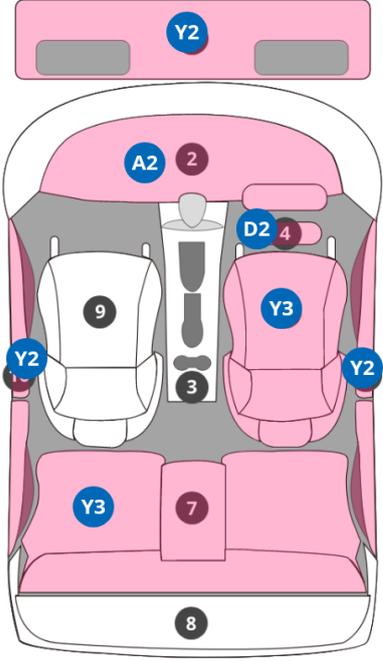
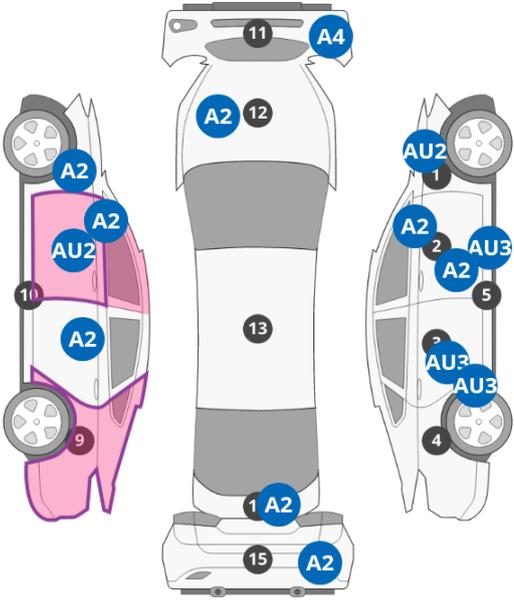
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.6	106	103	111
2	Boot Lid	99.6	100	99	100
3	Roof	89.2	95	86	89/88
4	Left Front Fender	100.7	102	102	98
5	Left Front Door	98.7	99	102	95
6	Center Panel Left				
7	Left Rear Door	138.3	140	135	140
8	Left Back Panel	104.3	111	99	103
9	Right Front Fender	96.5	97	99	94
10	Right Front Door	91.3	94	90	91
11	Center Panel Right				
12	Right Rear Door	88.5	84	88	94
13	Right Back Panel	95.8	93	94	100

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Front Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Small / (L) Rear Fender, Molding - Repair mark - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>A</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>Without warranty booklet, sest cover and tools. With spare tire and jack. 1 key. Without LTO plate.</p>