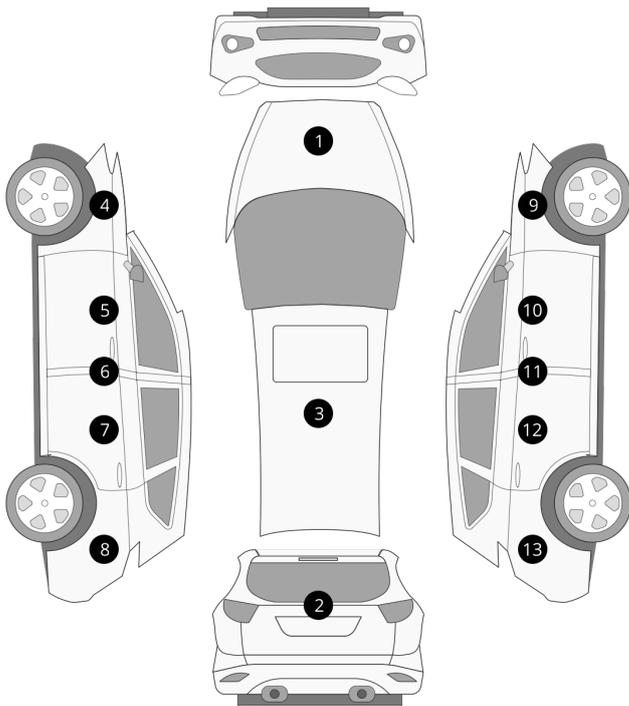


General Information

Date & Time: 02, May, 2025 11:02

Make	Toyota	Model	Innova
YOM	2020	Mileage	67,378
Registration No.	CAU2838	Chassis No.	PA2JA8EM5K0076117
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



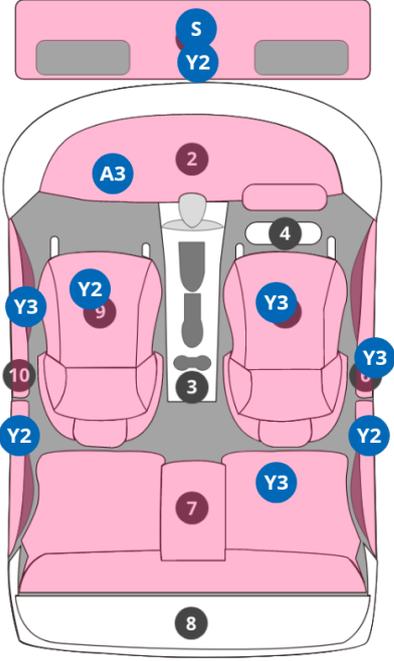
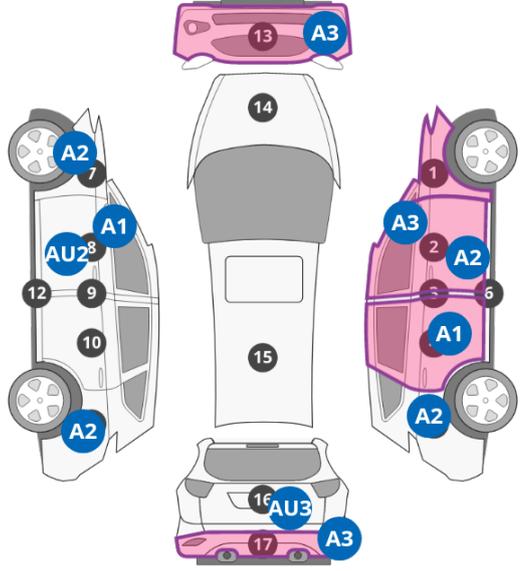
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	103	114	111
2	Boot Lid	118.3	131	103	121
3	Roof	85.6	90	88	82/82
4	Left Front Fender	95.7	100	97	90
5	Left Front Door	98.5	100	100	96
6	Center Panel Left				
7	Left Rear Door	96.3	96	101	93
8	Left Back Panel	367.3	636	213	253
9	Right Front Fender	158.3	157	169	149
10	Right Front Door	205.6	188	236	193
11	Center Panel Right				
12	Right Rear Door	215.0	185	190	270
13	Right Back Panel	102.3	102	105	100

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation :	C	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks Overall Interior - Smell - Yes / Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / Dashboard - Worn, Scratch, Cut, Crack - Medium / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Small</p>		<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / (R) Front Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Repair mark - Yes</p>	
Frame Evaluation :	C	Functional Evaluation :	A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>		<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes

Possible flooding. Original mattings missing. Without warranty booklet, jack, tools and seat cover. with spare tire. 1 key. With LTO plate. Has Gap at front and rear bumper.