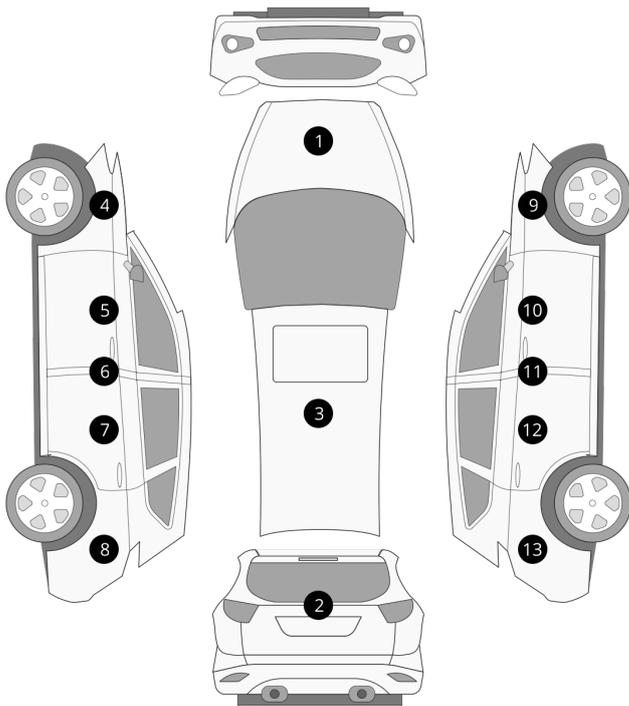


General Information

Date & Time: 02, May, 2025 14:03

Make	Isuzu	Model	D-MAX
YOM	2019	Mileage	77,192
Registration No.	NBO8172	Chassis No.	PABTFR87DJ2000911
CC	1.9	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



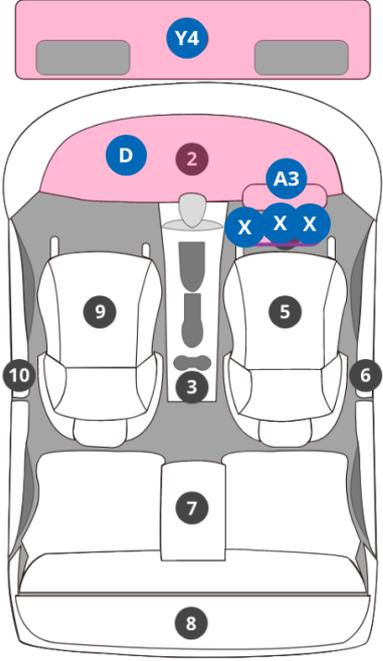
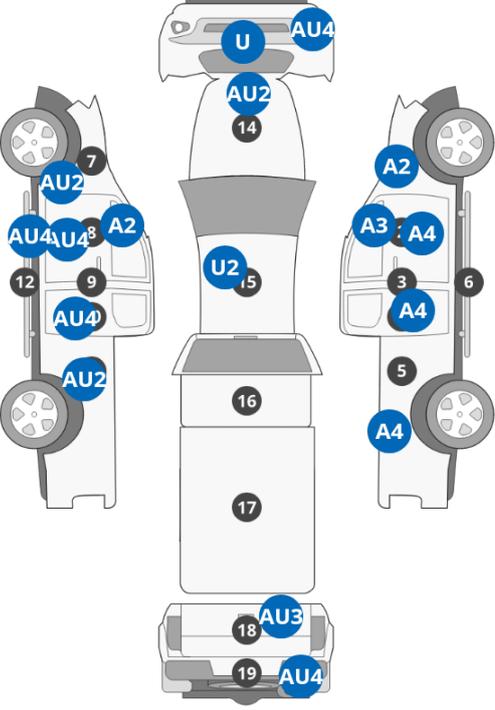
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	91.7	95	87	93
2	Boot Lid	99.9	91	102	107
3	Roof	90.7	78	91	105/89
4	Left Front Fender	86.5	86	86	88
5	Left Front Door	99.4	95	107	97
6	Center Panel Left				
7	Left Rear Door	106.7	124	98	98
8	Left Back Panel	143.3	164	108	158
9	Right Front Fender	89.1	92	90	86
10	Right Front Door	144.6	142	171	121
11	Center Panel Right				
12	Right Rear Door	135.3	123	133	150
13	Right Back Panel	135.6	112	162	133

Overall Evaluation :

D

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Large / (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Steering Wheel - Worn, Peel, Crack - Medium</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Small / (R) Mirror - Scratch - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Side Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Rear Gate - Scratch & Dent - Medium / (L) Side Gate - Scratch & Dent - Small / Roof - Dent - Small / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Crack taillight. Without warranty booklet, jack, tools and seat cover. With spare tire. 1 key. With 1 LTO plate. rear bumper partially missing.</p>