

General Information

Date & Time: 05, May, 2025 13:09

Make	Mazda	Model	Mazda 2
YOM	2019	Mileage	50,336
Registration No.	NED9825	Chassis No.	MM7DJ2HAAKW406577
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



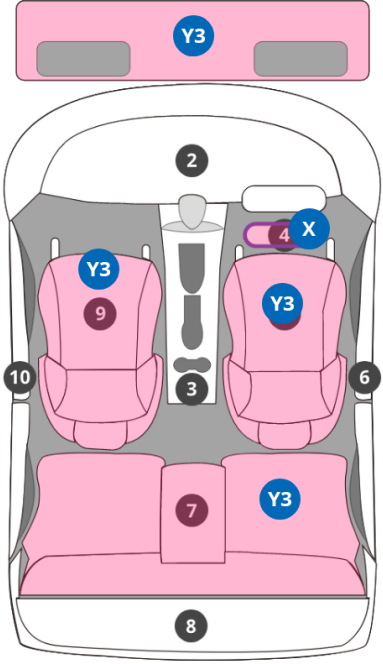
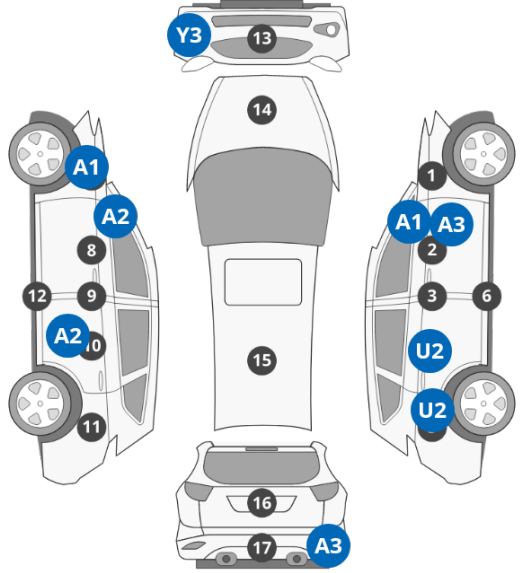
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.1	97	99	90
2	Boot Lid	109.0	108	117	102
3	Roof	87.6	87	81	93/90
4	Left Front Fender	164.0	160	160	172
5	Left Front Door	123.3	125	124	121
6	Center Panel Left				
7	Left Rear Door	102.6	105	103	100
8	Left Back Panel	95.5	98	91	98
9	Right Front Fender	99.0	102	100	95
10	Right Front Door	98.8	99	100	98
11	Center Panel Right				
12	Right Rear Door	101.2	96	102	106
13	Right Back Panel	109.3	102	105	121

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Medium</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (L) Mirror - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Dent - Small / (R) Rear Door, Molding - Dent - Small / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Without warranty booklet, seat cover and jack. with spare tire and incomplete tools. With LTO plate. 1 key.</p>