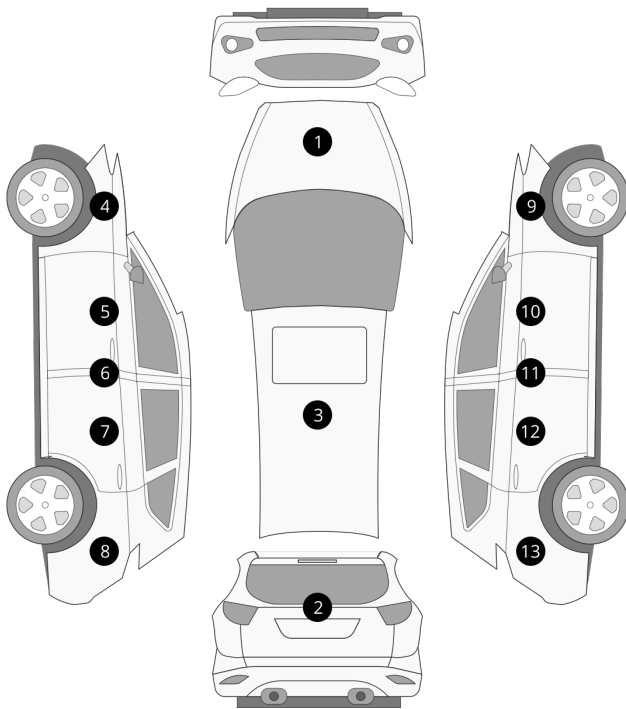


General Information

Date & Time: 09, May, 2025 10:18

Make	Toyota	Model	Vios
YOM	2021	Mileage	50,508
Registration No.	NEX7951	Chassis No.	PA1B18F3XM4149038
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



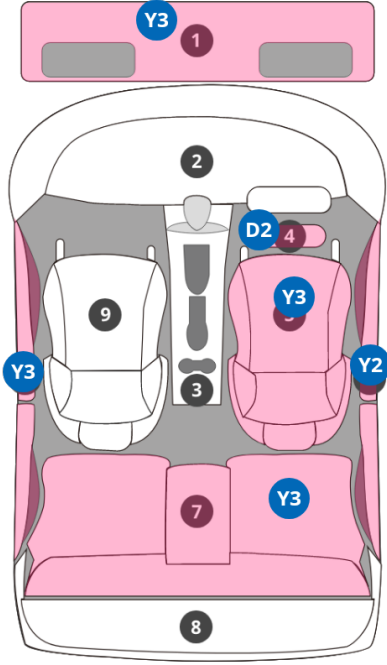
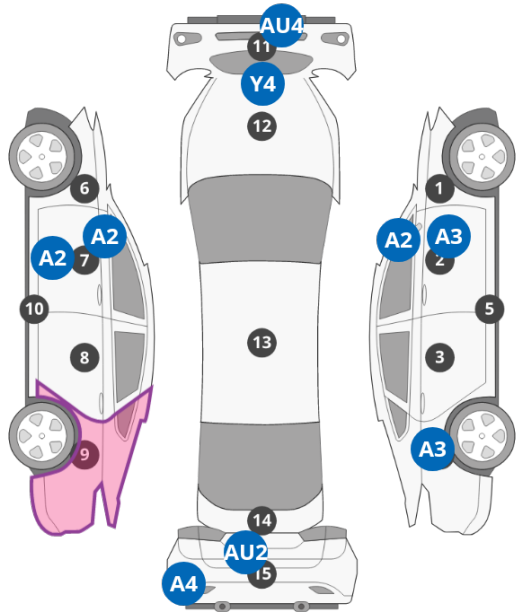
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	170.0	166	171	173
2	Boot Lid	103.0	99	103	107
3	Roof	106.1	119	96	100/110
4	Left Front Fender	129.6	137	133	119
5	Left Front Door	141.6	170	124	131
6	Center Panel Left				
7	Left Rear Door	140.0	137	142	141
8	Left Back Panel	122.6	120	121	127
9	Right Front Fender	152.6	130	170	158
10	Right Front Door	127.6	126	108	149
11	Center Panel Right				
12	Right Rear Door	119.3	127	114	117
13	Right Back Panel	127.3	118	125	139

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Worked - Small	Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Medium / Bonnet, Headlight - Crack, Gap - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Mirror - Scratch - Small / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Defects not found

Inspector Notes

Possible flooding. without warranty booklet, jack, tools and seat cover. 2 keys. with LTO plate.