

## General Information

Date & Time: 09, May, 2025 13:56

<b>Make</b>	Honda	<b>Model</b>	City
<b>YOM</b>	2018	<b>Mileage</b>	55,605
<b>Registration No.</b>	GAH9159	<b>Chassis No.</b>	PADGM6620JV412904
<b>CC</b>	1.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Gray		

## Body / Panel Condition



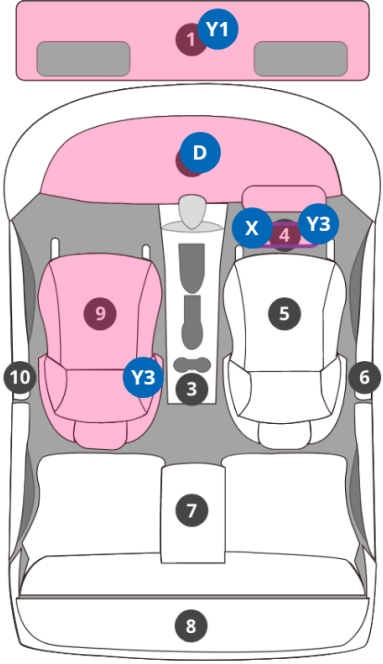
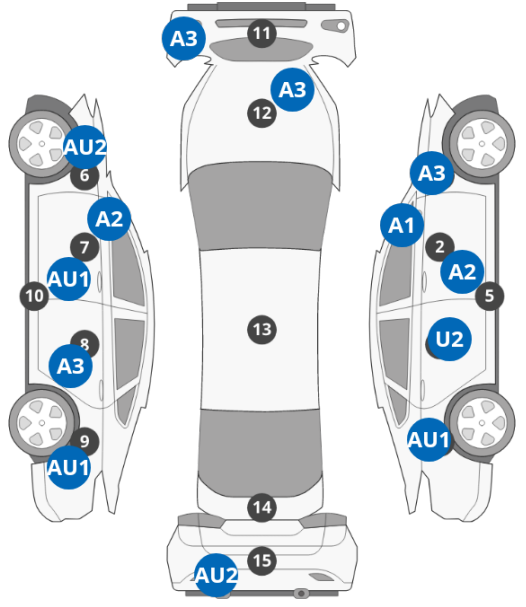
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	87.3	82	96	85
2	Boot Lid	116.9	122	87	142
3	Roof	87.9	84	108	73/86
4	Left Front Fender	79.6	84	78	77
5	Left Front Door	85.8	86	79	93
6	Center Panel Left				
7	Left Rear Door	86.6	95	85	80
8	Left Back Panel	89.8	100	87	83
9	Right Front Fender	78.2	80	77	78
10	Right Front Door	92.1	97	87	93
11	Center Panel Right				
12	Right Rear Door	104.3	101	101	111
13	Right Back Panel	94.6	89	90	105

Overall Evaluation :

**B**

### Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>B</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>C</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b>          Ceiling - Grime - Minimal / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Missing - Yes / (L) Front Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b>          (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Small / (R) Front Door, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Door, Molding - Dent - Small / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b>          Defects not found</p>	<p><b>Remarks</b>          Retractable Mirror - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With warranty booklet, spare tire and jack. Without tools and sest cover. 1 key. with LTO plate. Gap at front bumper.</p>