

## General Information

Date & Time: 03, Jun, 2025 13:15

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	93,264
<b>Registration No.</b>	NHI3935	<b>Chassis No.</b>	PA1B18F3XP4205564
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



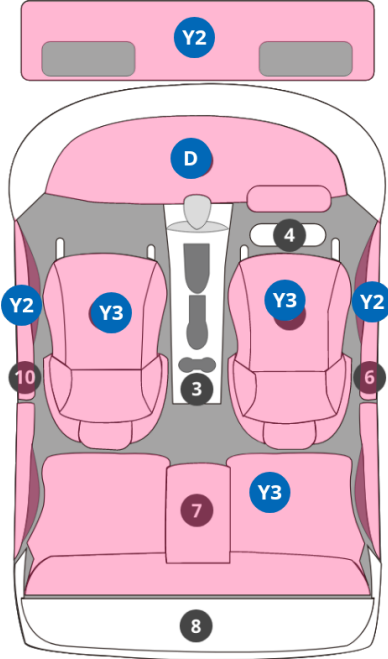
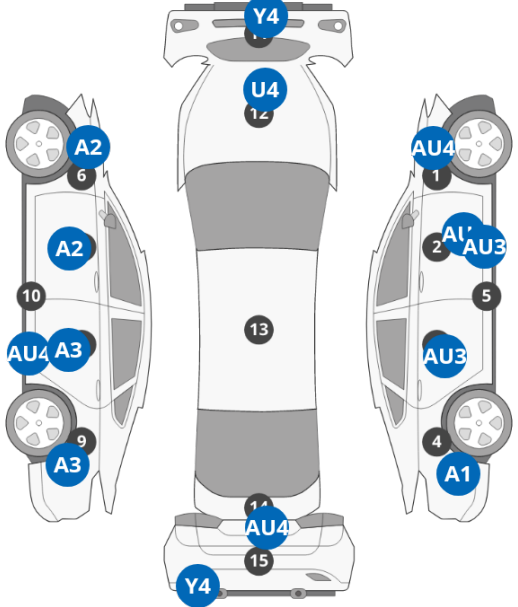
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.2	97	100	107
2	Boot Lid	104.6	100	108	106
3	Roof	94.0	101	93	97/85
4	Left Front Fender	90.2	85	95	91
5	Left Front Door	89.6	91	91	86
6	Center Panel Left				
7	Left Rear Door	102.6	90	103	115
8	Left Back Panel	141.0	168	150	105
9	Right Front Fender	90.7	91	87	94
10	Right Front Door	133.6	132	133	136
11	Center Panel Right				
12	Right Rear Door	89.8	80	89	100
13	Right Back Panel	88.9	90	85	93

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes</p>	<p><b>Remarks</b> (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch &amp; Dent - Large / Rear Bumper, Lamps, Panels - Crack, Gap - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Dent - Large / (L) Front Fender, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch &amp; Dent - Large / (R) Front Door, Molding - Scratch &amp; Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Medium / (R) Rear Door, Molding - Scratch &amp; Dent - Medium / (R) Rear Fender, Molding - Scratch - Minimal</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/with jack and incomplete tools/No warranty booklet/park light issue/plate light issue /left side tail light gap/No reverse camera/</p>