

## General Information

Date & Time: 21, May, 2025 15:55

<b>Make</b>	Nissan	<b>Model</b>	Terra
<b>YOM</b>	2019	<b>Mileage</b>	76,791
<b>Registration No.</b>	MAJ6024	<b>Chassis No.</b>	MNTJCAD23Z0008793
<b>CC</b>	2.5	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	SUV
<b>Colour</b>	Brown		

## Body / Panel Condition



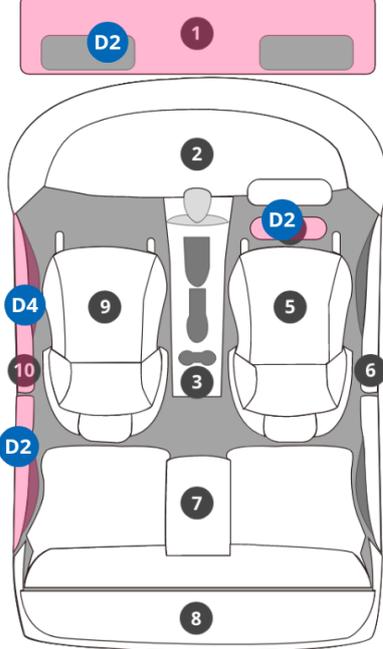
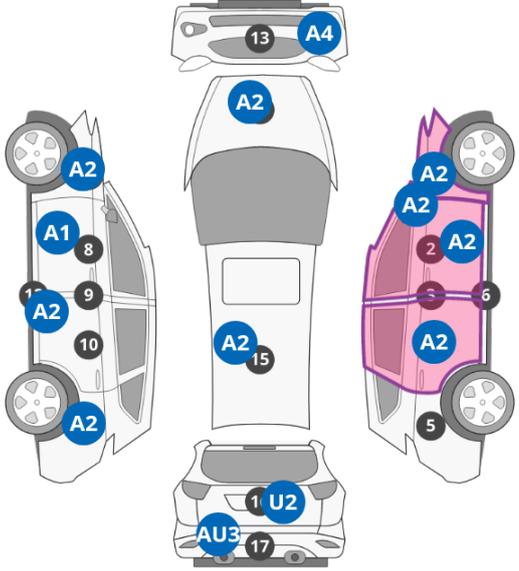
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	107	110	104
2	Boot Lid	99.1	105	87	105
3	Roof	93.8	77	70	117/111
4	Left Front Fender	95.1	97	91	97
5	Left Front Door	85.5	91	81	84
6	Center Panel Left				
7	Left Rear Door	90.3	93	87	92
8	Left Back Panel	100.6	95	104	103
9	Right Front Fender	263.0	451	147	191
10	Right Front Door	307.3	171	609	142
11	Center Panel Right				
12	Right Rear Door	181.3	183	201	160
13	Right Back Panel	110.2	95	110	126

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Overall Interior - Worn as per age - Yes / Ceiling - Crinkle - Small / (L) Front Floor Mat - Worked - Small / (L) Rear Trim - Worked - Small / (L) Front Trim - Worked - Large</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Large / Bonnet, Headlight - Scratch - Small / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch &amp; Dent - Medium / Trunk Hood, Rear Gate - Dent - Small / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Warning Lamps - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p><b>Inspector Notes</b></p>
<p>with warranty booklet and LTO plate, Jack and tools, Sparetire. scratch tail light and headlight, wind shield glass issue.</p>